

General Information

Date & Time: 01, Jul, 2025 13:51

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	28,376
Registration No.	NII6320	Chassis No.	MHKAB1BA6NJ037670
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



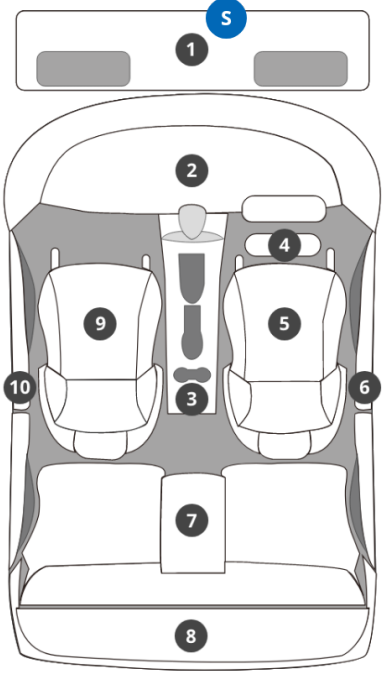
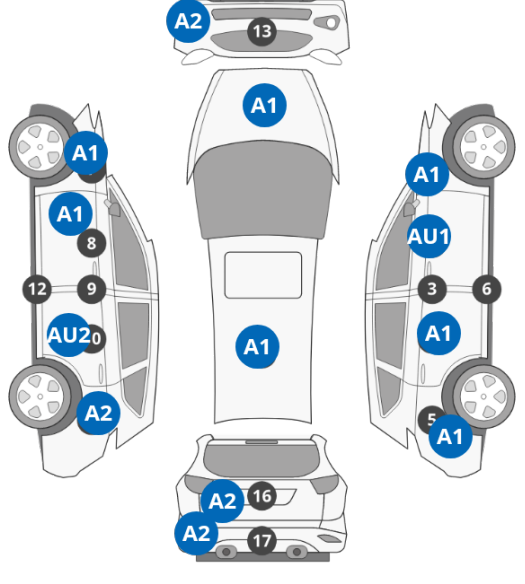
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	176.6	170	205	155
2	Boot Lid	100.0	96	109	95
3	Roof	105.5	120	119	92/91
4	Left Front Fender	110.3	109	117	105
5	Left Front Door	114.3	111	121	111
6	Center Panel Left				
7	Left Rear Door	107.6	112	109	102
8	Left Back Panel	98.3	97	94	104
9	Right Front Fender	153.6	144	151	166
10	Right Front Door	155.6	145	160	162
11	Center Panel Right				
12	Right Rear Door	100.0	98	96	106
13	Right Back Panel	93.9	90	92	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate. no Tools and jack, Spare tire and warranty booklet. scratch headlight and tail light. unusual sound on engine