

General Information

Date & Time: 30, Jun, 2025 17:53

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,865
Registration No.	NHG3118	Chassis No.	PA1B18F3XP4227788
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



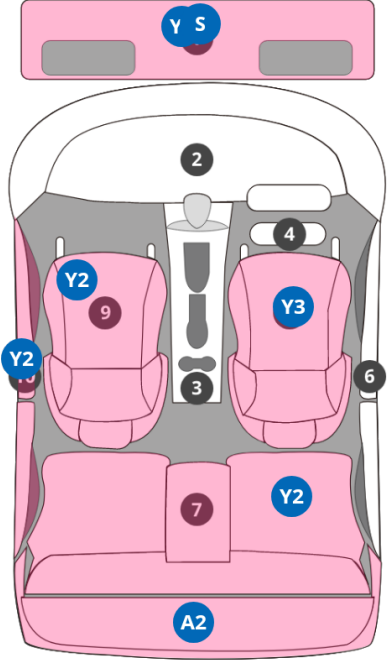
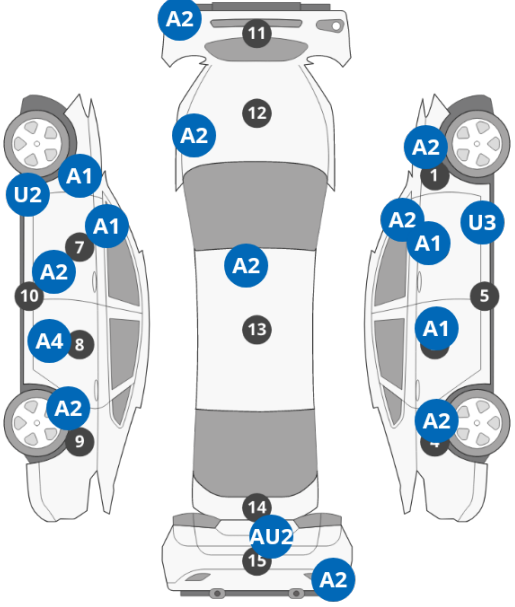
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.0	136	113	129
2	Boot Lid	117.6	113	122	118
3	Roof	106.2	102	104	106/113
4	Left Front Fender	106.3	109	99	111
5	Left Front Door	111.0	114	109	110
6	Center Panel Left				
7	Left Rear Door	112.0	110	108	118
8	Left Back Panel	116.6	125	115	110
9	Right Front Fender	121.0	132	116	115
10	Right Front Door	114.0	113	114	115
11	Center Panel Right				
12	Right Rear Door	114.6	105	116	123
13	Right Back Panel	124.0	115	114	143

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and tools, with spare tire, weak battery