

General Information

Date & Time: 27, Jun, 2025 14:59

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	69,841
Registration No.	NEM9818	Chassis No.	PA1B18F37M4164807
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



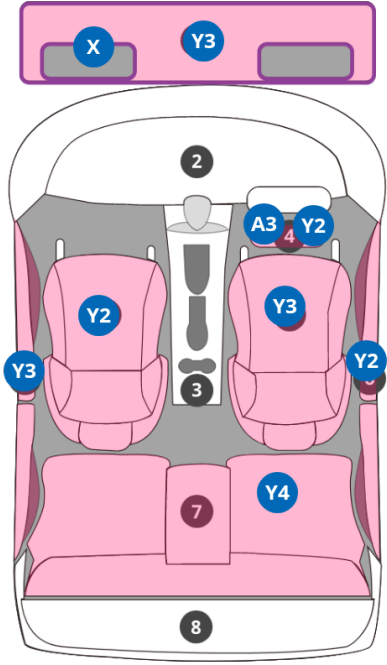
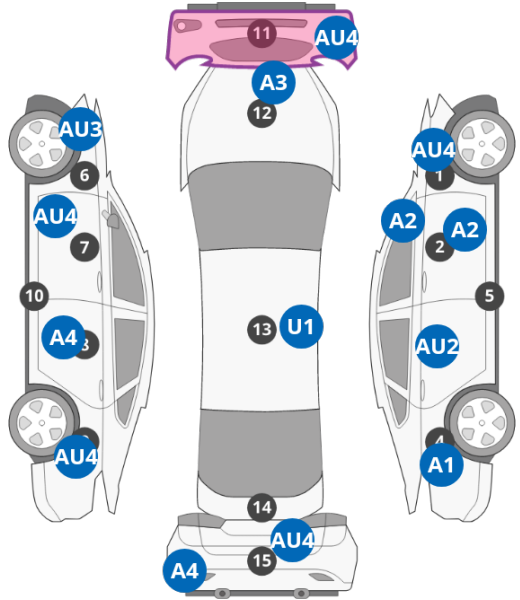
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	164.0	174	143	175
2	Boot Lid	97.2	99	94	99
3	Roof	101.0	112	88	108/96
4	Left Front Fender	126.6	128	129	123
5	Left Front Door	102.4	100	98	109
6	Center Panel Left				
7	Left Rear Door	107.9	116	108	100
8	Left Back Panel	103.6	103	104	104
9	Right Front Fender	94.2	97	97	89
10	Right Front Door	97.3	94	102	96
11	Center Panel Right				
12	Right Rear Door	115.3	115	111	120
13	Right Back Panel	95.6	90	93	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Large / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Missing - Yes	Remarks Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Minimal / Bonnet, Headlight - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Crack taillight. Reverse light missing. Left headlight lowbeam issue. Left sunvisor missing. Without warranty booklet,jack,tools, and seat cover. With spare tire. 1 key. With LTO plate. Adhesive marks rear view mirror.