

General Information

Date & Time: 27, Jun, 2025 16:44

Make	Suzuki	Model	S-Presso
YOM	2021	Odo Meter Reading	37,421
Registration No.	FAI3897	Chassis No.	MA3FK41S1NA250368
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



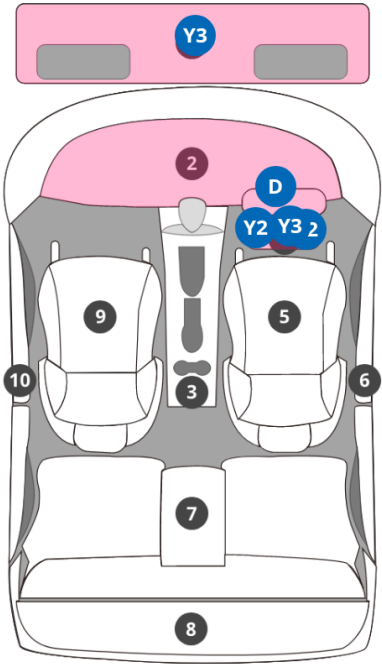
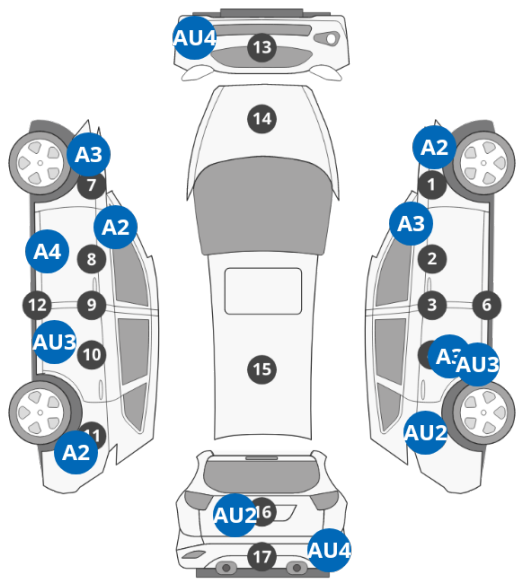
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.9	98	94	96
2	Boot Lid	105.0	105	103	107
3	Roof	98.5	108	102	94/90
4	Left Front Fender	96.5	92	100	97
5	Left Front Door	99.7	100	103	96
6	Center Panel Left				
7	Left Rear Door	91.2	97	89	88
8	Left Back Panel	94.1	94	96	93
9	Right Front Fender	101.7	106	105	94
10	Right Front Door	98.6	90	101	105
11	Center Panel Right				
12	Right Rear Door	89.4	88	93	88
13	Right Back Panel	98.3	92	104	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / (L) Front Floor Mat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Gap at front bumper. With warranty booklet, spare tire, jack and tools. 1 key. With LTO plate.