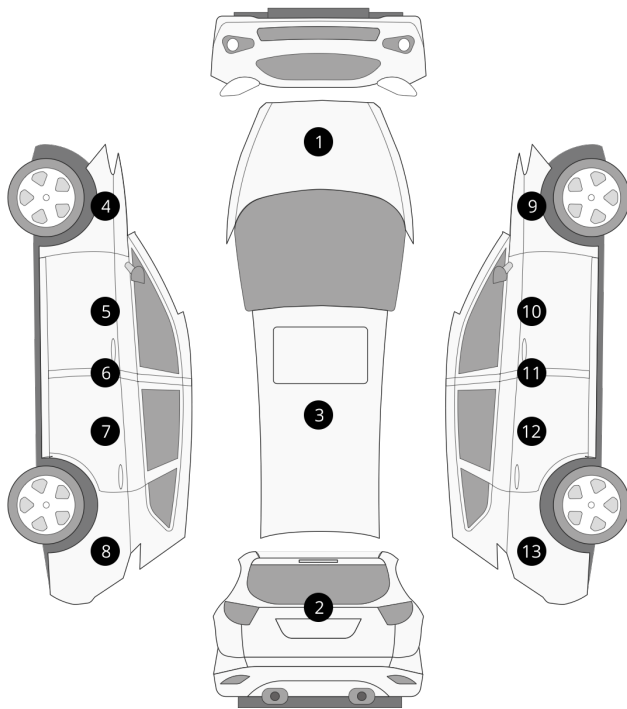


General Information

Date & Time: 30, Jun, 2025 15:33

Make	Toyota	Model	Hilux
YOM	2023	Odo Meter Reading	12,674
Registration No.	DBI7496	Chassis No.	MR0JB8DD4P3213764
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



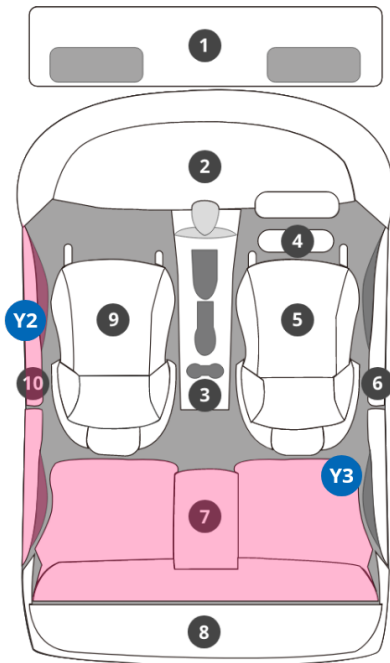
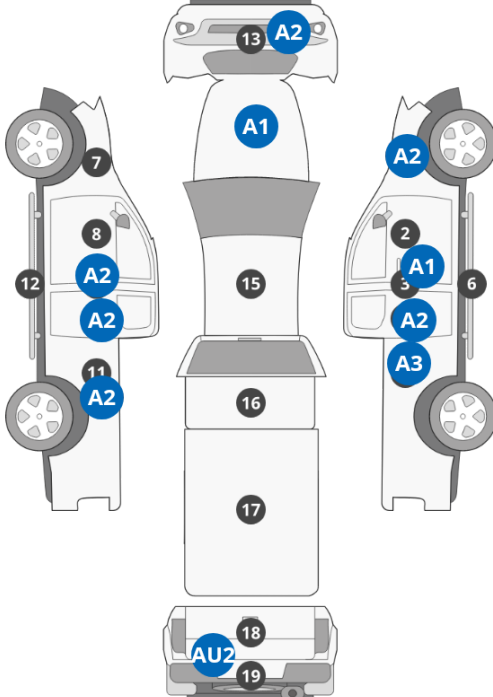
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	136.6	132	136	142
2	Boot Lid	103.9	96	106	110
3	Roof	119.5	116	120	117/125
4	Left Front Fender	108.6	110	105	111
5	Left Front Door	113.3	114	111	115
6	Center Panel Left				
7	Left Rear Door	107.0	111	107	103
8	Left Back Panel	114.0	125	109	108
9	Right Front Fender	116.0	125	111	112
10	Right Front Door	122.6	127	121	120
11	Center Panel Right				
12	Right Rear Door	122.6	115	121	132
13	Right Back Panel	119.0	116	118	123

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light