

General Information

Date & Time: 01, Jul, 2025 16:01

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	38,585
Registration No.	DBM8685	Chassis No.	PA1B18F33R4246329
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



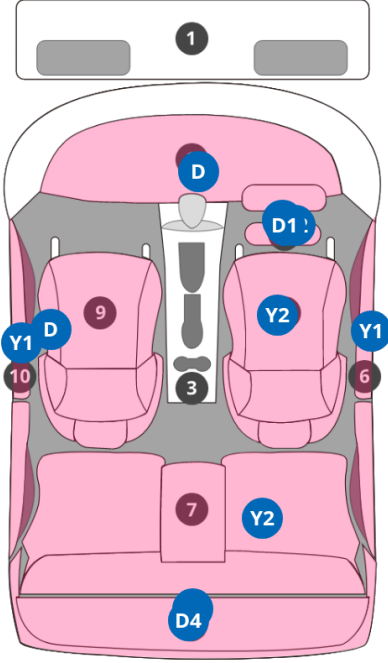
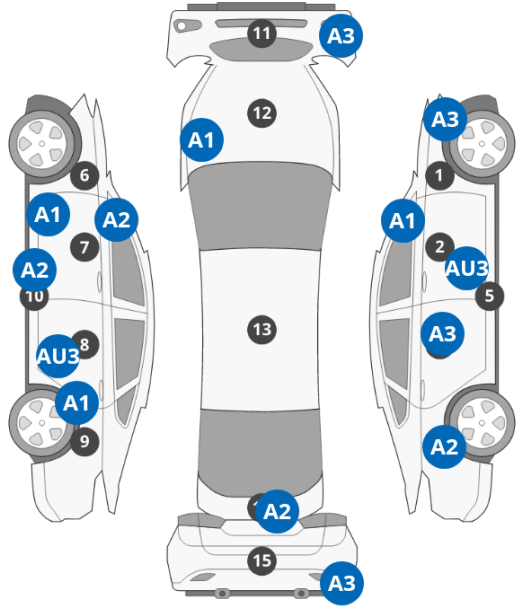
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	127	119	125
2	Boot Lid	119.0	117	118	122
3	Roof	115.2	120	113	101/127
4	Left Front Fender	105.6	104	103	110
5	Left Front Door	121.0	109	115	139
6	Center Panel Left				
7	Left Rear Door	112.0	113	118	105
8	Left Back Panel	121.0	132	124	107
9	Right Front Fender	134.6	177	114	113
10	Right Front Door	113.0	113	110	116
11	Center Panel Right				
12	Right Rear Door	113.6	108	106	127
13	Right Back Panel	122.0	123	115	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Trunk Room - Loose, Deformed - Large / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Minimal / Carpet - Worked - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, spare tire cover missing