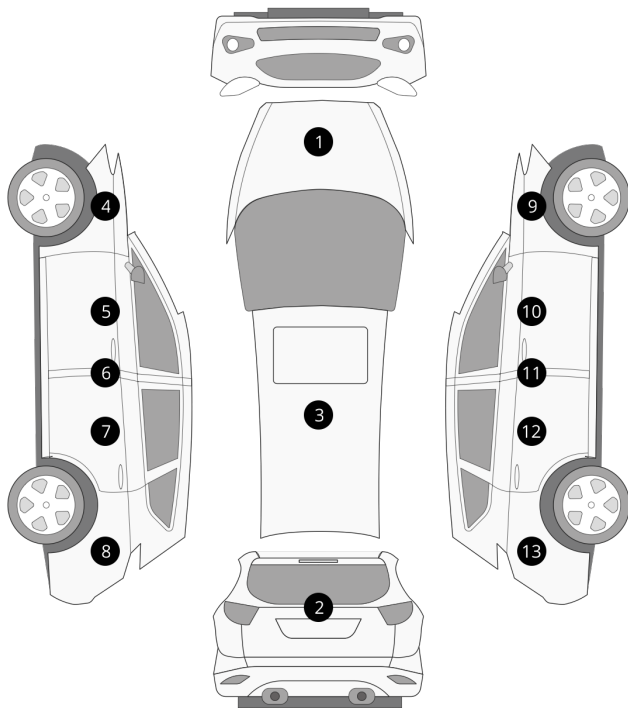


General Information

Date & Time: 01, Jul, 2025 15:04

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	34,471
Registration No.	EAG3982	Chassis No.	PA1B18F38P4216399
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



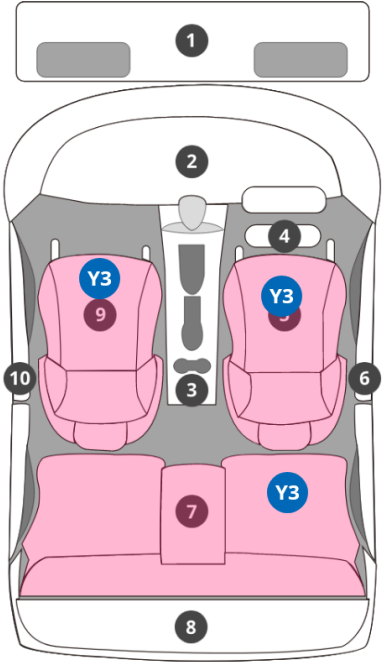
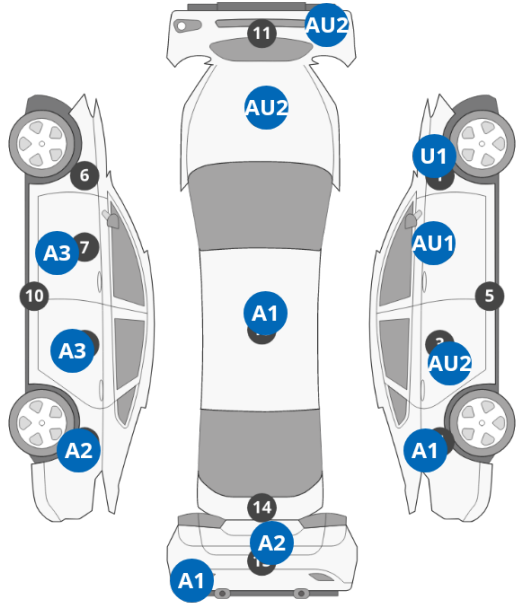
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	139	122	121
2	Boot Lid	122.0	116	124	126
3	Roof	111.0	120	114	102/108
4	Left Front Fender	106.6	105	105	110
5	Left Front Door	112.6	108	110	120
6	Center Panel Left				
7	Left Rear Door	130.3	129	137	125
8	Left Back Panel	122.3	127	118	122
9	Right Front Fender	105.0	107	101	107
10	Right Front Door	109.0	106	106	115
11	Center Panel Right				
12	Right Rear Door	113.3	109	110	121
13	Right Back Panel	121.3	118	116	130

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium	Remarks (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate and Jack, Sparetire and incomplete tools. no warranty booklet and scratch tail lights and head lights.