

General Information

Date & Time: 27, Jun, 2025 17:18

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	119,250
Registration No.	NFU1166	Chassis No.	MK2XRNC1WKN061707
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



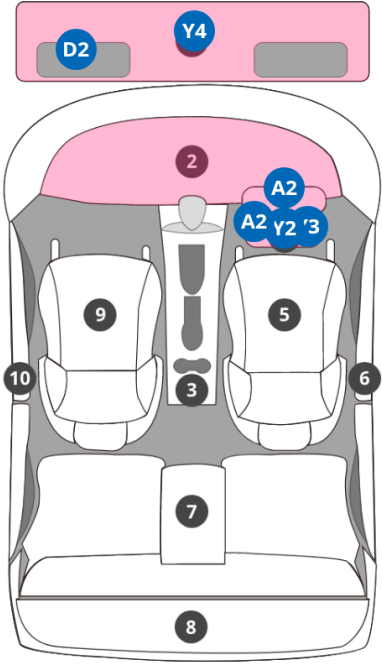
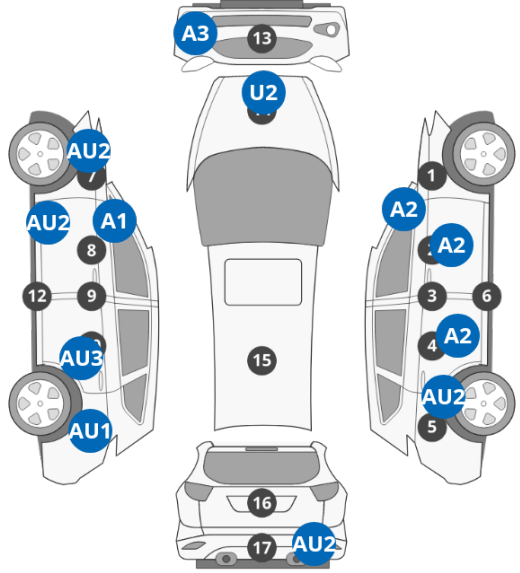
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.9	97	97	100
2	Boot Lid	345.4	850	100	86
3	Roof	106.7	116	105	105/101
4	Left Front Fender	96.3	97	100	92
5	Left Front Door	105.3	109	102	105
6	Center Panel Left				
7	Left Rear Door	99.5	100	99	100
8	Left Back Panel	105.7	106	114	97
9	Right Front Fender	94.1	96	94	92
10	Right Front Door	102.6	100	103	105
11	Center Panel Right				
12	Right Rear Door	94.6	95	96	94
13	Right Back Panel	113.6	108	119	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Sunvisor, Sunglass Holder - Crinkle - Small / Steering Wheel - Worn, Peel, Crack - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
Carkey battery low. Without warranty booklet. With Spare tire,jack,tools and leather seat cover. 2 keys. with LTO plate