

General Information

Date & Time: 28, Jun, 2025 09:41

Make	Mitsubishi	Model	Mirage
YOM	2019	Odo Meter Reading	51,732
Registration No.	NFU9430	Chassis No.	PAEA13TXKK009552
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



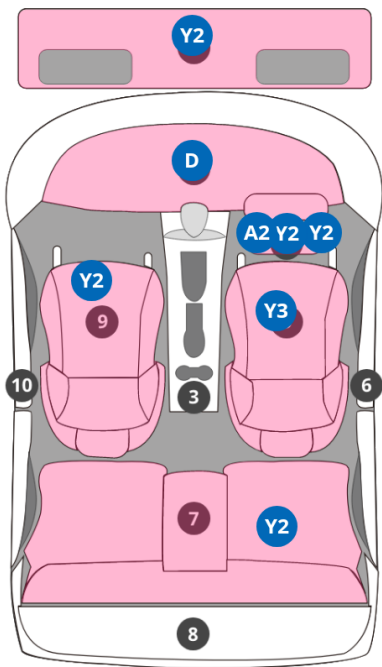
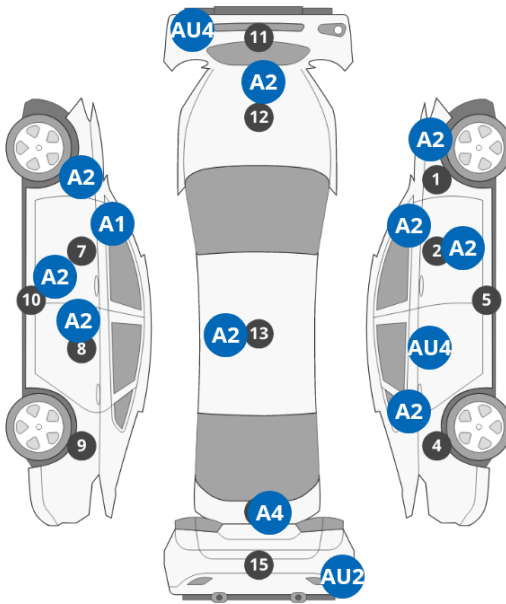
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	183.6	177	196	178
2	Boot Lid	182.0	172	190	184
3	Roof	99.7	96	106	91/106
4	Left Front Fender	195.0	260	167	158
5	Left Front Door	211.3	232	197	205
6	Center Panel Left				
7	Left Rear Door	221.6	221	207	237
8	Left Back Panel	277.0	367	234	230
9	Right Front Fender	242.0	203	317	206
10	Right Front Door	160.3	161	156	164
11	Center Panel Right				
12	Right Rear Door	149.3	150	143	155
13	Right Back Panel	175.0	164	163	198

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / Mat Other - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Seat - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Maintenance warning lamp. Crack and loose right taillight. Right Headlight issue. Right taillight not working. Gap at rear bumper. Without warranty booklet, seat cover and tools. With spare tire and jack. 1 key. With LTO plate.