

General Information

Date & Time: 30, Jun, 2025 14:48

Make	Ford	Model	Explorer
YOM	2018	Odo Meter Reading	63,016
Registration No.	NBF7713	Chassis No.	1FM5K8GT4JGA93723
CC	3.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



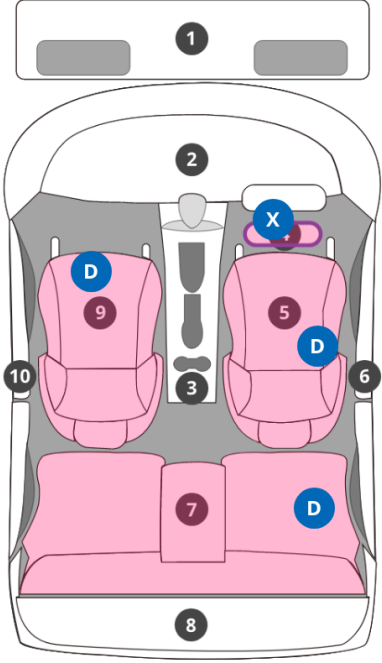
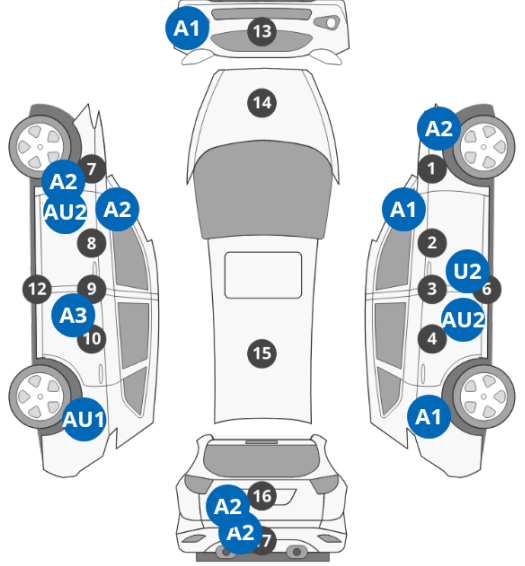
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.3	136	131	139
2	Boot Lid	158.3	148	186	141
3	Roof	148.5	154	165	138/137
4	Left Front Fender	163.0	149	181	159
5	Left Front Door	165.0	159	169	167
6	Center Panel Left				
7	Left Rear Door	173.3	177	185	158
8	Left Back Panel	154.3	159	163	141
9	Right Front Fender	154.6	146	171	147
10	Right Front Door	161.3	164	164	156
11	Center Panel Right				
12	Right Rear Door	169.0	160	174	173
13	Right Back Panel	155.0	151	150	164

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Worn - Yes / Mat Other - Missing - Yes / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes	Remarks (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, orn issue