

General Information

Date & Time: 28, Jun, 2025 12:25

Make	Nissan	Model	Navara
YOM	2022	Odo Meter Reading	80,869
Registration No.	BAC5645	Chassis No.	MNTCCAD23Z0010484
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



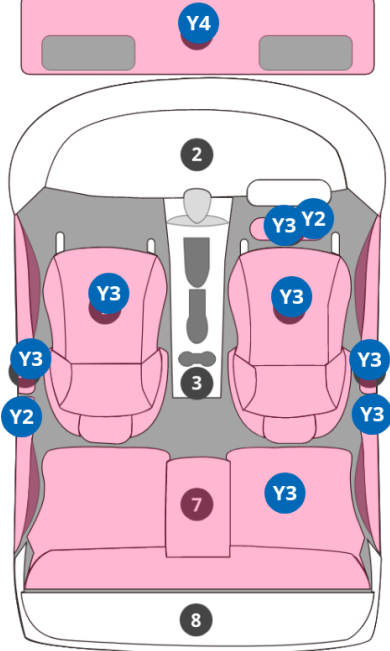
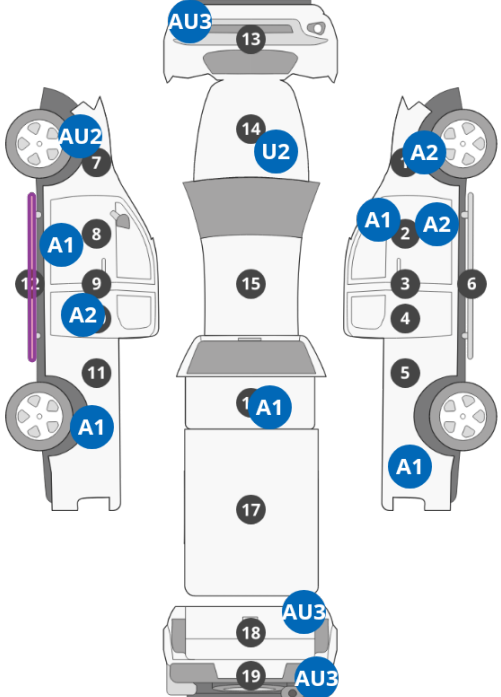
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	112	103	107
2	Boot Lid	131.3	122	139	133
3	Roof	83.2	77	86	77/93
4	Left Front Fender	104.1	106	109	97
5	Left Front Door	84.8	86	88	80
6	Center Panel Left				
7	Left Rear Door	88.8	88	92	86
8	Left Back Panel	118.0	111	122	121
9	Right Front Fender	104.6	102	110	102
10	Right Front Door	91.0	82	91	100
11	Center Panel Right				
12	Right Rear Door	95.1	94	97	94
13	Right Back Panel	127.0	129	136	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Partially Missing - Yes / (L) Side Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Medium / (R) Side Gate - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Cab Back Panel - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet. With spare tire, jack and tools. 1 key. no LTO plate. interior light issue.