

General Information

Date & Time: 28, Jun, 2025 16:47

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	27,135
Registration No.	NFC9871	Chassis No.	PA1B18F3XP4221733
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



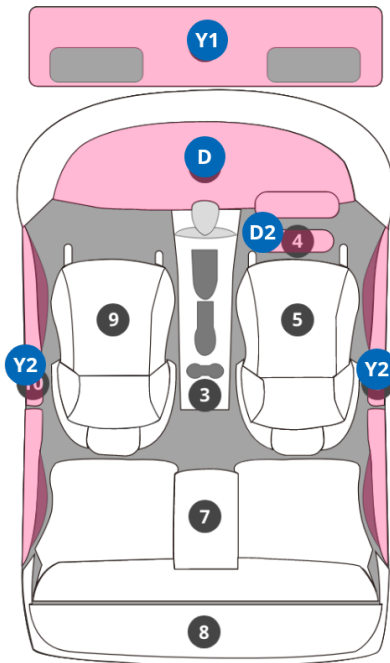
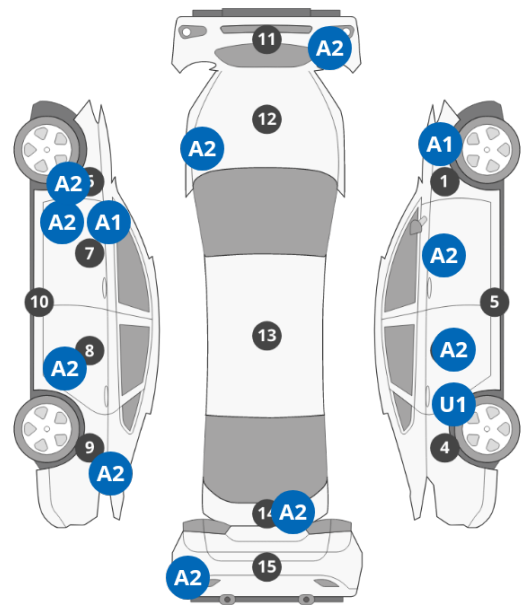
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.2	95	118	109
2	Boot Lid	111.0	107	111	115
3	Roof	106.0	95	102	125/102
4	Left Front Fender	105.3	115	101	100
5	Left Front Door	97.2	99	95	99
6	Center Panel Left				
7	Left Rear Door	102.6	108	101	99
8	Left Back Panel	111.6	122	103	110
9	Right Front Fender	100.4	99	100	102
10	Right Front Door	100.2	101	100	100
11	Center Panel Right				
12	Right Rear Door	102.8	101	97	110
13	Right Back Panel	102.5	99	100	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
Without warranty booklet and spare tire. Incomplete tools. With jack and seat cover. 2 keys. With LTO plate.