

General Information

Date & Time: 30, Jun, 2025 12:21

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,118
Registration No.	IAF4603	Chassis No.	PA1B18F3XR4251236
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



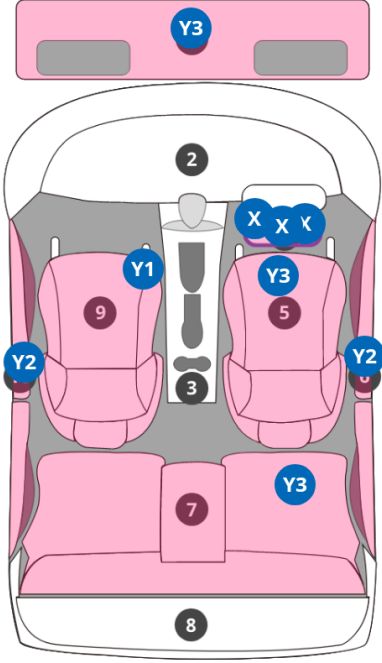
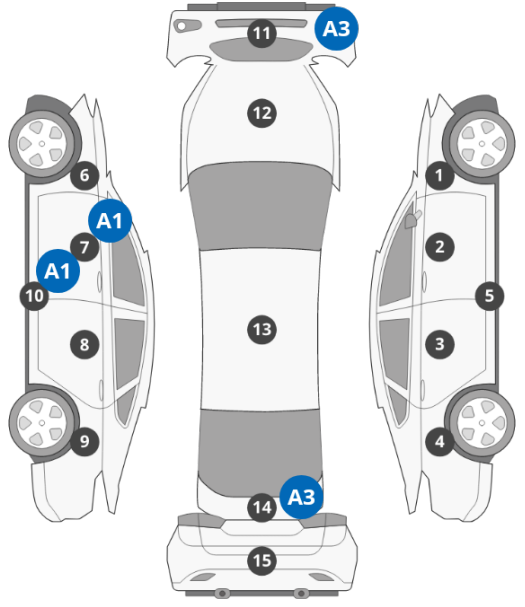
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	115	102	110
2	Boot Lid	108.6	103	112	111
3	Roof	107.6	107	111	100/113
4	Left Front Fender	103.6	107	102	102
5	Left Front Door	100.8	101	100	102
6	Center Panel Left				
7	Left Rear Door	108.3	111	111	103
8	Left Back Panel	109.6	118	106	105
9	Right Front Fender	110.3	112	112	107
10	Right Front Door	107.6	109	107	107
11	Center Panel Right				
12	Right Rear Door	115.0	106	109	130
13	Right Back Panel	110.0	109	107	114

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal	Remarks (L) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
Adhesive marks at both side mirrors. Without warranty booklet, spare tire, jack and tools. With seat cover. 3 keys. With LTO plate