

General Information

Date & Time: 30, Jun, 2025 15:08

Make	Toyota	Model	Hilux
YOM	2022	Odo Meter Reading	134,697
Registration No.	BAC3294	Chassis No.	MR0JB8DD3M383765
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



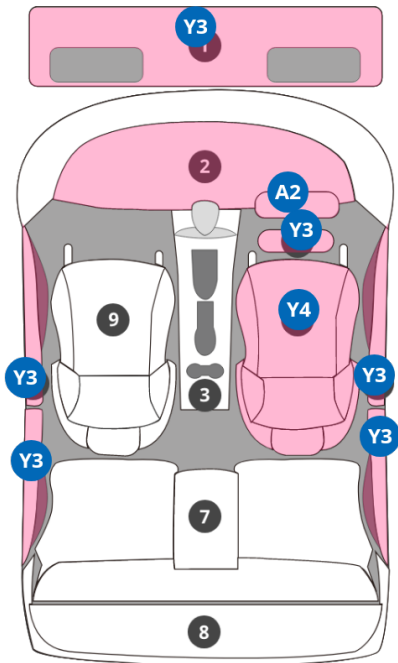
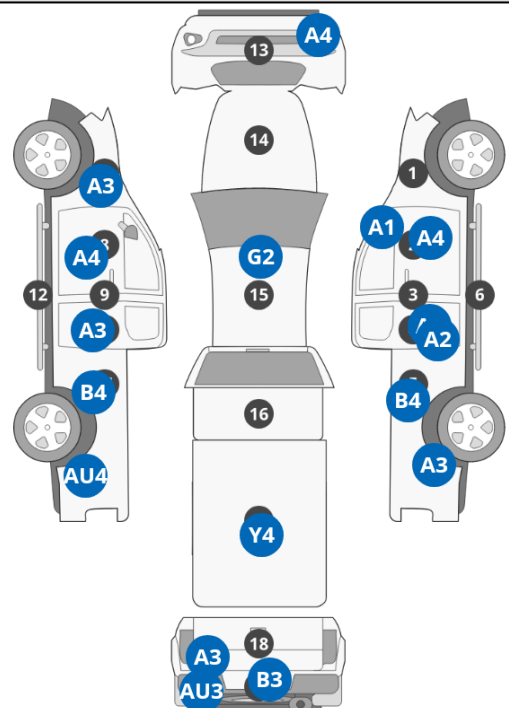
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	122	128	119
2	Boot Lid	108.0	110	107	107
3	Roof	109.2	116	102	111/108
4	Left Front Fender	119.6	123	119	117
5	Left Front Door	110.0	114	112	104
6	Center Panel Left				
7	Left Rear Door	107.3	115	104	103
8	Left Back Panel	116.6	113	119	118
9	Right Front Fender	117.6	116	112	125
10	Right Front Door	105.3	105	104	107
11	Center Panel Right				
12	Right Rear Door	101.6	100	101	104
13	Right Back Panel	114.0	117	110	115

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / Ceiling - Grime - Medium / (R) Rear Trim - Grime - Medium / Mat Other - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small	Remarks Cargo Bed Floor - Crack, Gap - Large / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Modified - Medium / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Side Gate - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Corner Panel - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Front Windshield - Scratch, Stone chip - Small / (L) Side Gate - Modified - Large / (R) Side Gate - Modified - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. left parklight issue. Cargofloor Gap. small crack at front windshield. Without warranty booklet. With Spare tire,jack and tools. 1 key. With LTO plate