

General Information

Date & Time: 30, Jun, 2025 16:39

Make	Toyota	Model	Rush
YOM	2022	Odo Meter Reading	62,326
Registration No.	CAW7324	Chassis No.	MHKR8FF3PMK037171
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



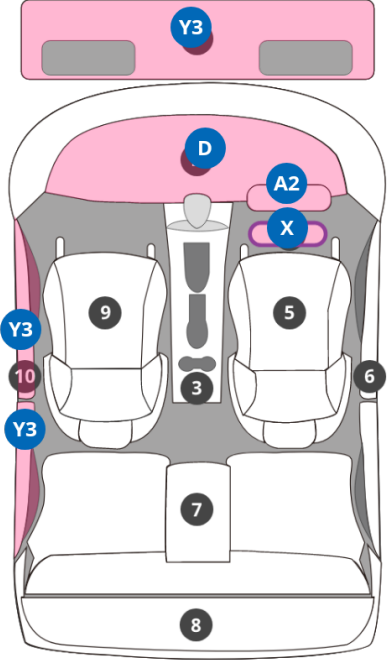
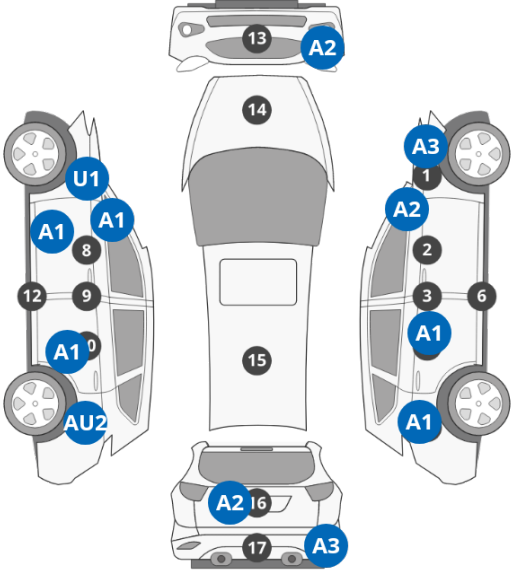
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	143.0	146	137	146
2	Boot Lid	88.0	94	80	91
3	Roof	98.1	95	92	104/101
4	Left Front Fender	124.0	141	115	116
5	Left Front Door	148.3	147	151	147
6	Center Panel Left				
7	Left Rear Door	106.0	110	106	102
8	Left Back Panel	102.3	104	104	99
9	Right Front Fender	123.0	127	121	121
10	Right Front Door	153.3	156	155	149
11	Center Panel Right				
12	Right Rear Door	110.6	106	115	111
13	Right Back Panel	97.7	95	97	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Mat Other - Missing - Yes / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
Low Battery. Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. With LTO plate.