

General Information

Date & Time: 30, Jun, 2025 12:45

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	62,440
Registration No.	DAT8092	Chassis No.	PA1B18F39L4130768
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



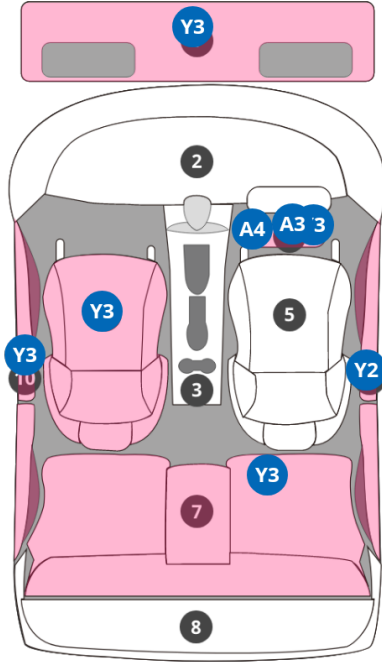
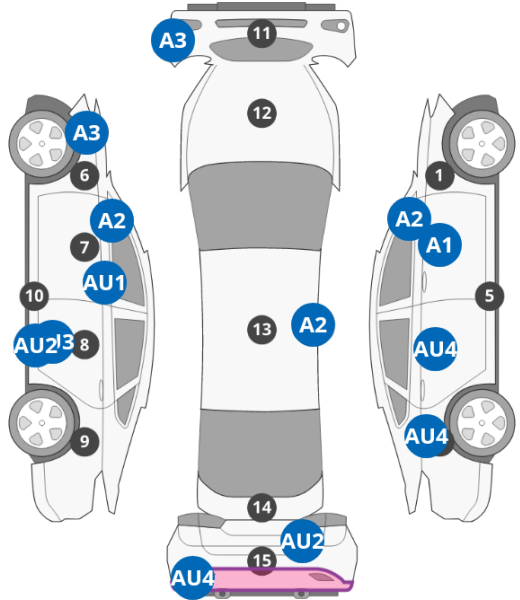
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	103	104	116
2	Boot Lid	109.6	109	107	113
3	Roof	99.4	109	94	98/97
4	Left Front Fender	98.1	98	99	97
5	Left Front Door	104.0	103	101	108
6	Center Panel Left				
7	Left Rear Door	112.0	119	111	106
8	Left Back Panel	120.6	131	116	115
9	Right Front Fender	96.3	94	100	95
10	Right Front Door	97.3	104	91	97
11	Center Panel Right				
12	Right Rear Door	134.3	133	134	136
13	Right Back Panel	100.9	102	99	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Large / Carpet - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. grime at center console. Low Battery. Steering issue. Without warranty booklet,jack and tools. With spare tire and seat cover. 1 key. With LTO plate. grimes on seat covers.