

General Information

Date & Time: 30, Jun, 2025 13:08

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	86,395
Registration No.	VAB1551	Chassis No.	PA1B18F32M4155318
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



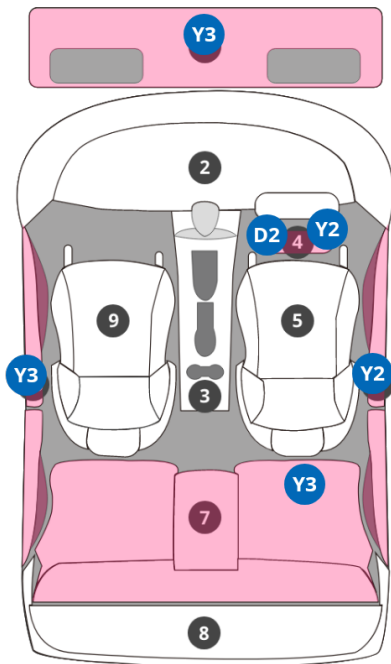
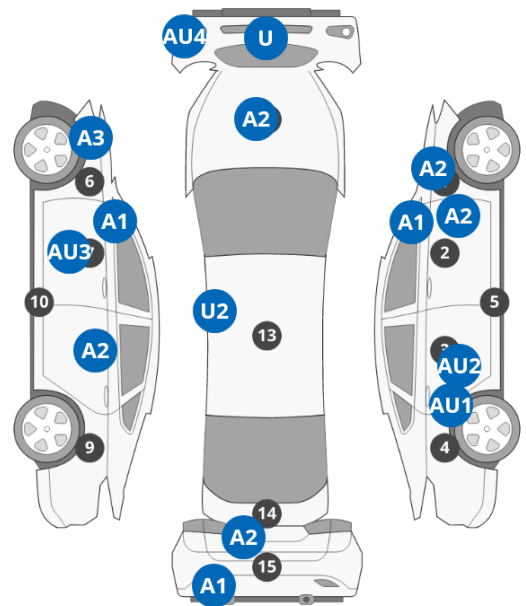
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	106	103	114
2	Boot Lid	111.0	107	111	115
3	Roof	101.1	109	97	93/105
4	Left Front Fender	102.6	100	105	103
5	Left Front Door	103.2	113	99	98
6	Center Panel Left				
7	Left Rear Door	101.3	101	102	101
8	Left Back Panel	117.3	137	104	111
9	Right Front Fender	102.3	103	104	100
10	Right Front Door	104.0	104	104	104
11	Center Panel Right				
12	Right Rear Door	107.0	95	112	114
13	Right Back Panel	116.0	107	116	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Rear Bumper, Lamps, Panels - Scratch - Minimal / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding, Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. With LTO plate. car stickers around the exterior. Front toe hook cover partially missing.</p>