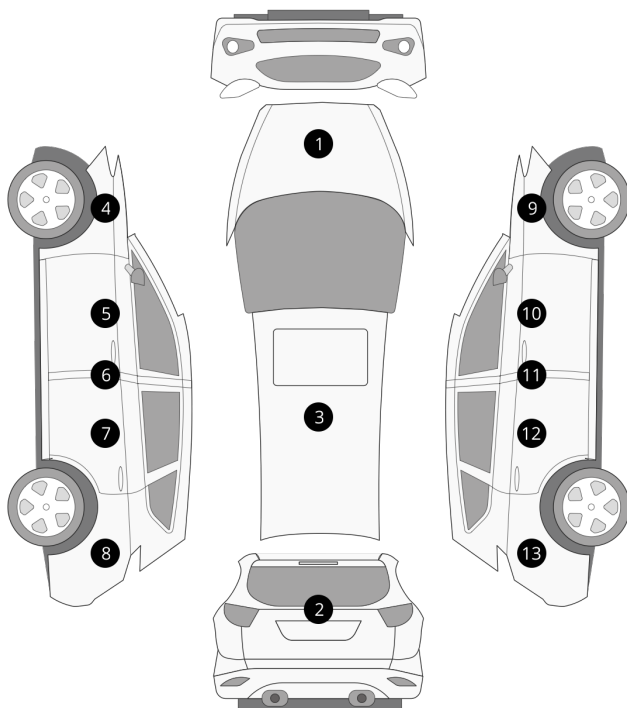


General Information

Date & Time: 30, Jun, 2025 15:49

Make	MG	Model	ZS
YOM	2020	Odo Meter Reading	43,635
Registration No.	NGN3215	Chassis No.	LSJW74U9XLLZ041692
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



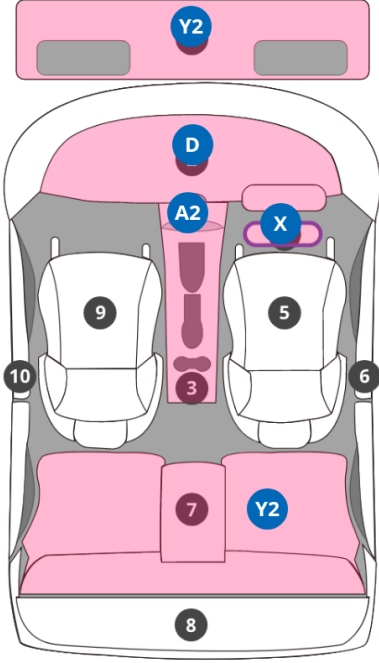
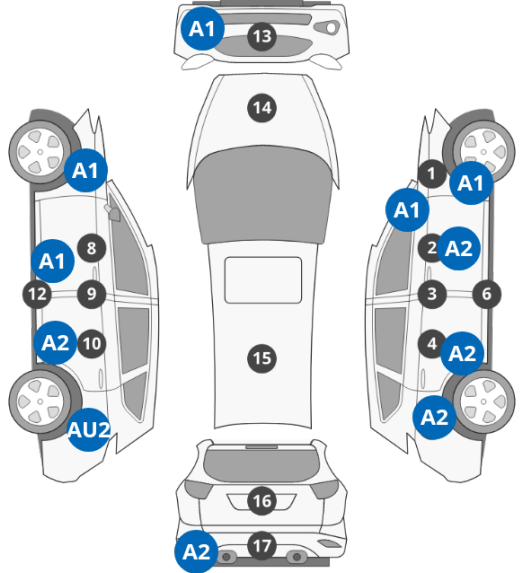
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.3	128	131	120
2	Boot Lid	124.0	121	128	123
3	Roof	121.5	117	125	124/120
4	Left Front Fender	110.0	117	105	108
5	Left Front Door	124.0	122	123	127
6	Center Panel Left				
7	Left Rear Door	125.6	122	132	123
8	Left Back Panel	195.6	149	161	277
9	Right Front Fender	114.0	113	112	117
10	Right Front Door	123.6	127	119	125
11	Center Panel Right				
12	Right Rear Door	123.0	124	127	118
13	Right Back Panel	120.3	116	123	122

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With warranty booklet, spare tire, jack and tools. 2 key.s. with LTO plate.