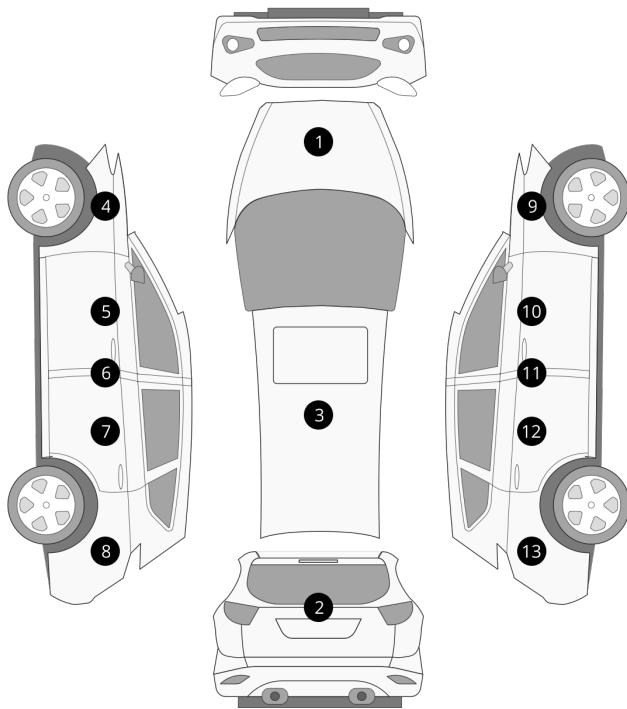


General Information

Date & Time: 03, Jul, 2025 07:38

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	40,246
Registration No.	DBO1655	Chassis No.	MHKU3FE10PK005745
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Pickup
Colour	White		

Body / Panel Condition



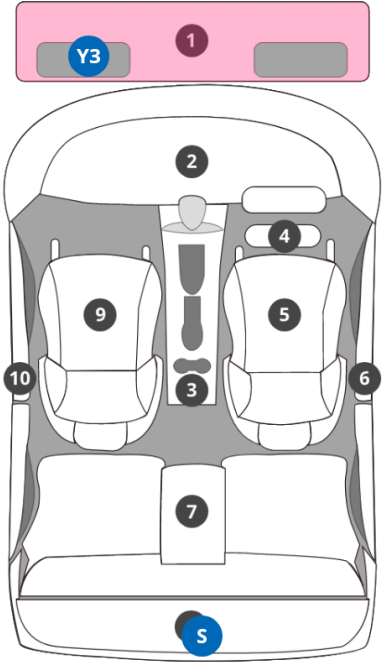
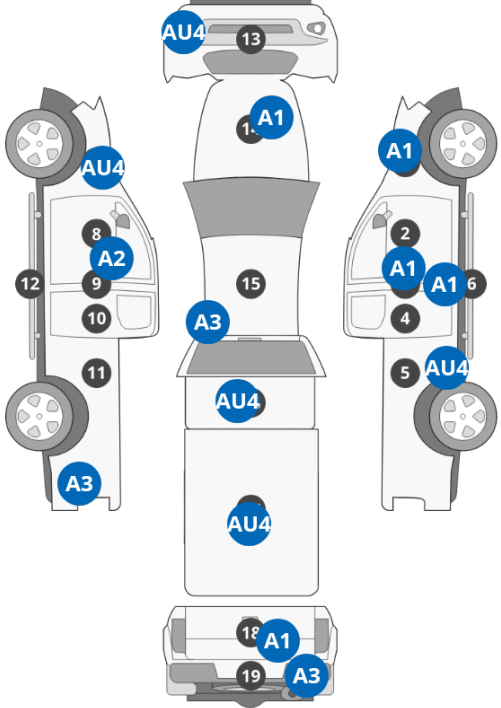
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	64.3	57	69	67
2	Boot Lid	77.7	90	61	83
3	Roof	62.0	54	72	59/63
4	Left Front Fender	67.0	68	64	69
5	Left Front Door	65.1	71	62	63
6	Center Panel Left	65.4	71	65	61
7	Left Rear Door				
8	Left Back Panel	80.3	66	89	86
9	Right Front Fender	70.5	71	82	59
10	Right Front Door	59.6	59	61	59
11	Center Panel Right	71.3	77	65	73
12	Right Rear Door				
13	Right Back Panel	111.3	106	123	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Medium / Cargo Bed Floor - Scratch & Dent - Large / Cab Back Panel - Scratch & Dent - Large / Roof - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Panel - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes

with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight, cracked tail light, plate and reverse light issue, left and back door issue, battery weak, power steering issue due to weak battery, front right panel bent