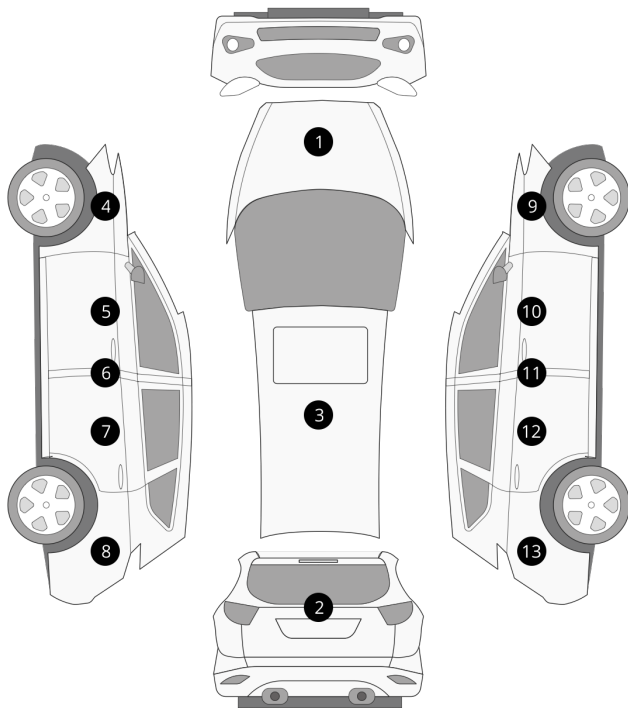


General Information

Date & Time: 02, Jul, 2025 15:05

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	36,157
Registration No.	NKD8970	Chassis No.	PA1B18F30R4258311
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



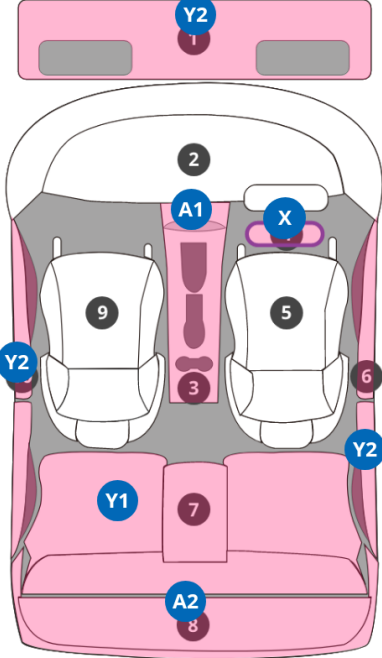
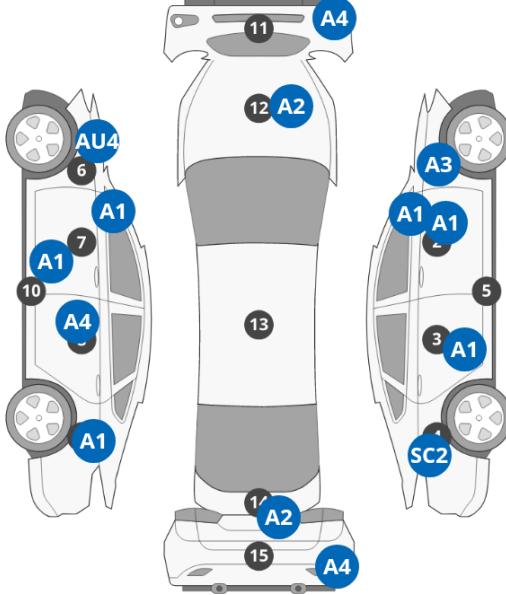
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	145	113	122
2	Boot Lid	126.0	130	120	128
3	Roof	120.5	126	124	113/119
4	Left Front Fender	116.6	128	110	112
5	Left Front Door	116.3	116	110	123
6	Center Panel Left				
7	Left Rear Door	125.0	138	123	114
8	Left Back Panel	121.0	131	120	112
9	Right Front Fender	123.6	125	120	126
10	Right Front Door	126.3	125	128	126
11	Center Panel Right				
12	Right Rear Door	121.6	116	119	130
13	Right Back Panel	124.0	128	121	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / (R) Rear Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Trim - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Rust, Corrosion - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes

Inspector Notes

with LTO plate, no warranty booklet, with jack, incomplete tools, with spare tire, busted headlight