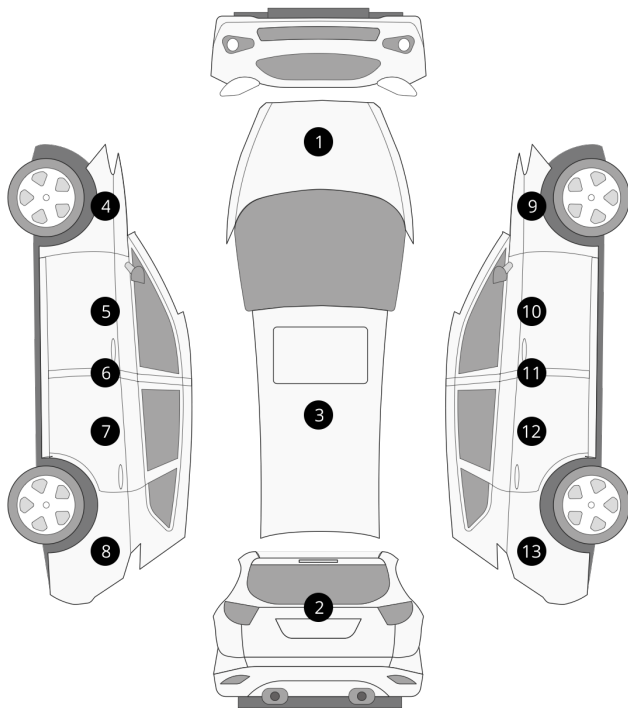


General Information

Date & Time: 16, Jul, 2025 10:05

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	25,199
Registration No.	BAG3071	Chassis No.	PA2JA8EMXR0141554
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



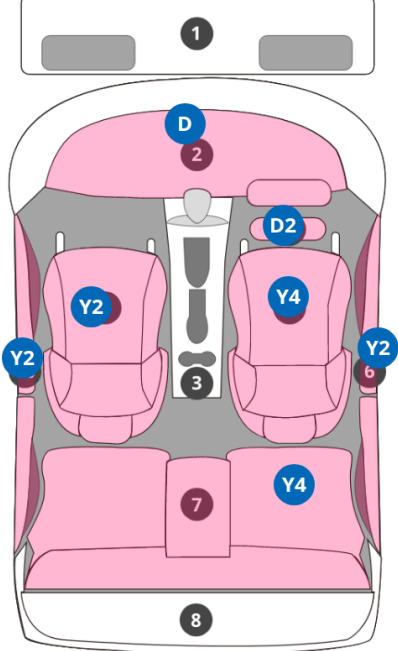
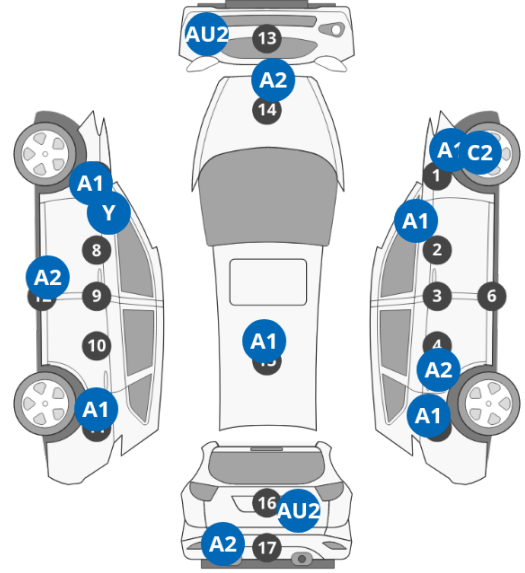
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	112	128	114
2	Boot Lid	100.3	106	98	97
3	Roof	96.3	95	93	103/95
4	Left Front Fender	95.6	94	91	102
5	Left Front Door	95.1	88	100	98
6	Center Panel Left				
7	Left Rear Door	103.0	124	94	91
8	Left Back Panel	98.0	101	97	96
9	Right Front Fender	95.8	101	95	92
10	Right Front Door	96.1	99	94	96
11	Center Panel Right				
12	Right Rear Door	102.8	97	98	114
13	Right Back Panel	110.0	100	106	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, no jack and tools, with spare tire, damaged left side mirror, busted headlights high and low beam