

General Information

Date & Time: 02, Jul, 2025 16:09

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	51,110
Registration No.	DAV1242	Chassis No.	PA1B18F31M4142401
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



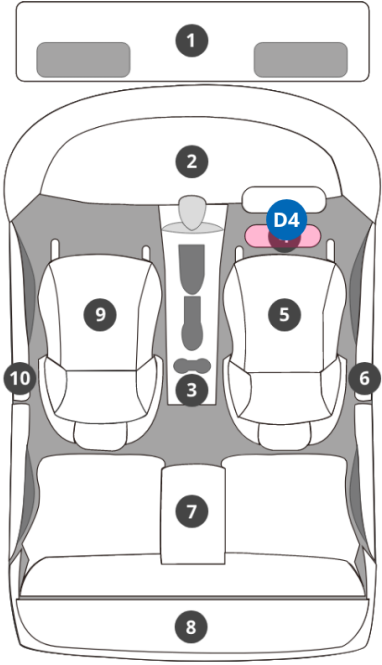
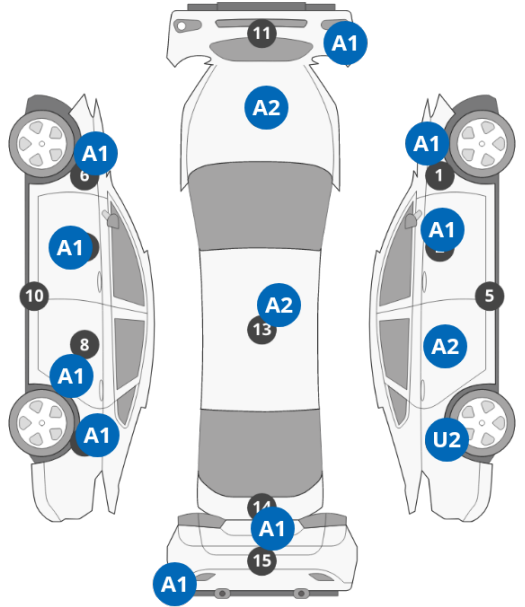
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	122	114	119
2	Boot Lid	128.0	125	127	132
3	Roof	113.5	118	111	111/114
4	Left Front Fender	110.3	112	112	107
5	Left Front Door	111.0	115	111	107
6	Center Panel Left				
7	Left Rear Door	112.0	117	111	108
8	Left Back Panel	121.6	124	119	122
9	Right Front Fender	104.8	109	98	107
10	Right Front Door	111.3	109	113	112
11	Center Panel Right				
12	Right Rear Door	115.0	111	114	120
13	Right Back Panel	115.6	106	106	135

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Large	Remarks (R) Rear Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate and Jack, Sparetire and incomplete tools. without warranty booklet and scratch tail lights and head lights.