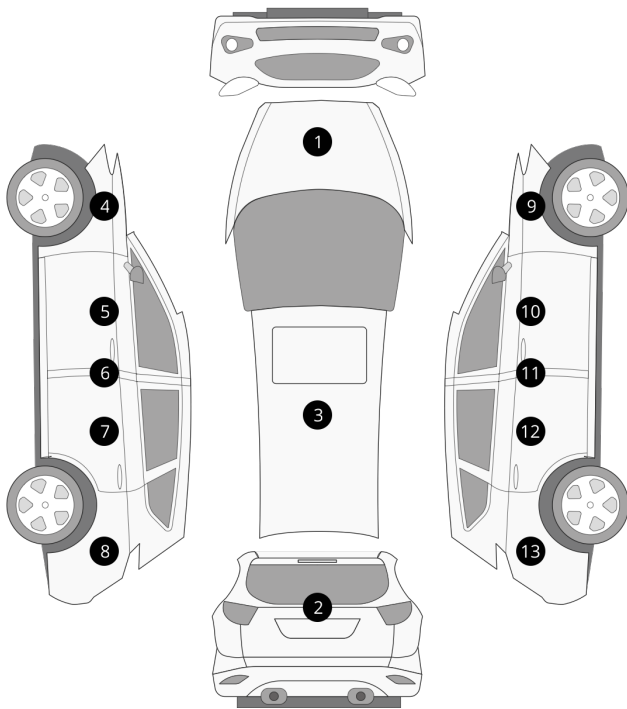


General Information

Date & Time: 04, Nov, 2024 15:39

Make	Toyota	Model	Vios
YOM	2024	Mileage	17,221
Registration No.	BAF8520	Chassis No.	PA1B18F31R4241291
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



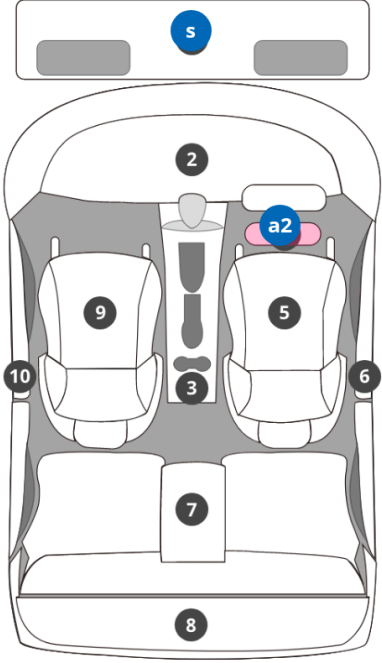
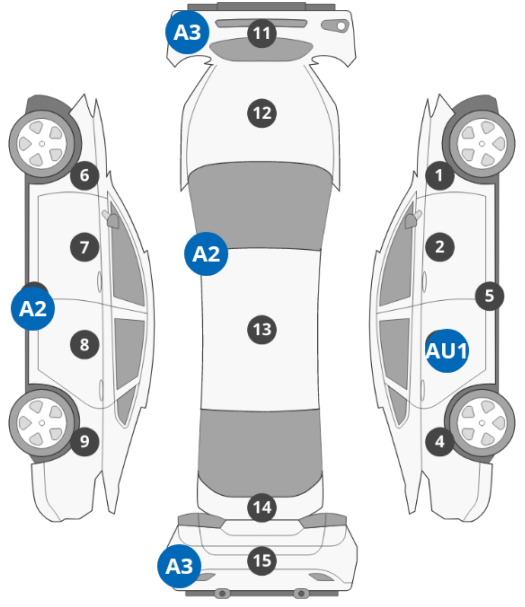
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	128	117	124
2	Boot Lid	117.6	117	118	118
3	Roof	115.2	116	113	112/120
4	Left Front Fender	110.0	114	108	108
5	Left Front Door	119.6	119	115	125
6	Center Panel Left				
7	Left Rear Door	120.0	127	120	113
8	Left Back Panel	120.0	125	119	116
9	Right Front Fender	115.0	115	117	113
10	Right Front Door	116.6	119	115	116
11	Center Panel Right				
12	Right Rear Door	122.6	116	121	131
13	Right Back Panel	121.6	121	117	127

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Floor Lag - Cut, Crack - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
hairline scratches around the exterior.