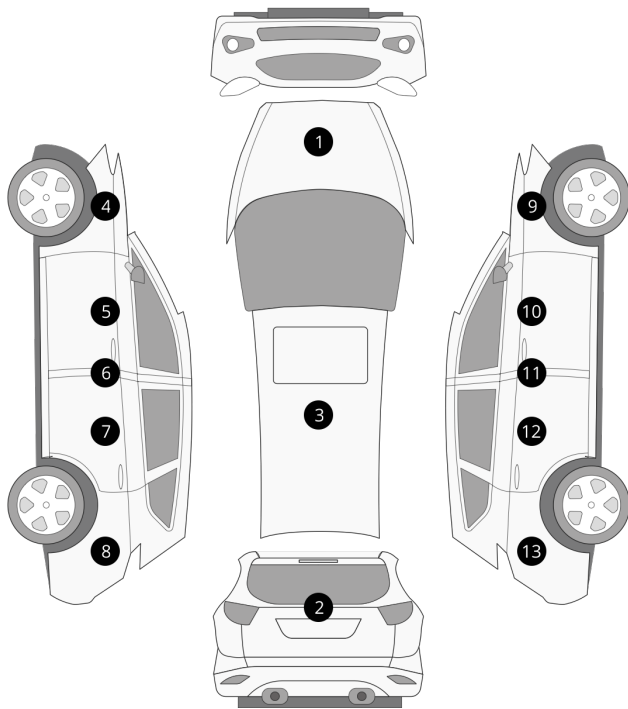


General Information

Date & Time: 14, Jul, 2025 14:29

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	18,167
Registration No.	DBF7635	Chassis No.	JTFNAFAP6P8039812
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



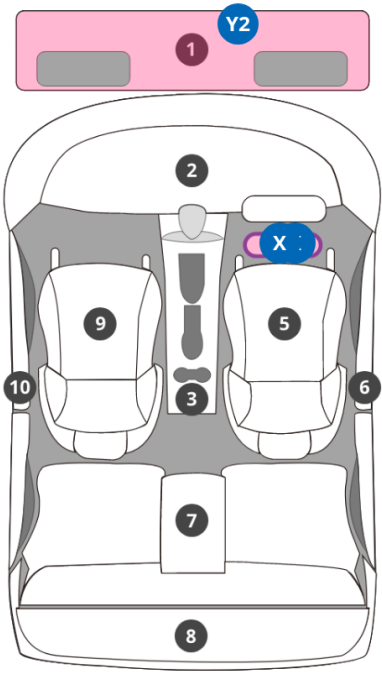
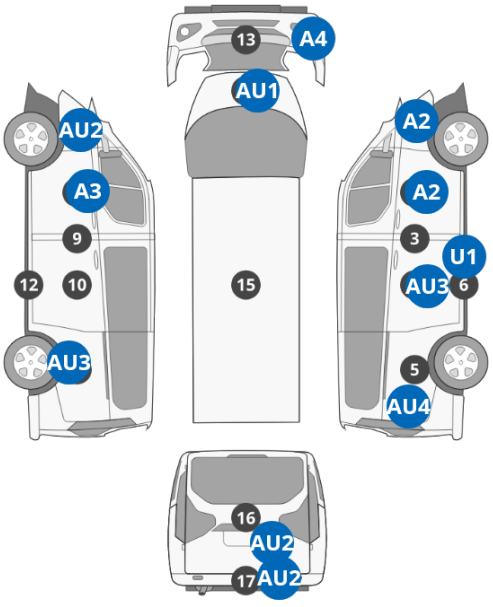
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	127	106	119
2	Boot Lid	113.3	108	113	119
3	Roof	124.0	128	122	129/117
4	Left Front Fender	105.0	103	105	107
5	Left Front Door	116.0	123	112	113
6	Center Panel Left	118.0	111	120	123
7	Left Rear Door				
8	Left Back Panel	104.0	107	100	105
9	Right Front Fender	108.0	104	107	113
10	Right Front Door	106.0	104	107	107
11	Center Panel Right	119.0	117	124	116
12	Right Rear Door	113.3	111	109	120
13	Right Back Panel	108.0	106	108	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Dent - Minimal / (R) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With warranty booklet and LTO Plate, Sparetire. no Tools and Jack , Crack tail light, scratch headlight and tail light.