

## General Information

Date & Time: 05, Nov, 2024 14:37

|                  |         |              |                   |
|------------------|---------|--------------|-------------------|
| Make             | Toyota  | Model        | Vios              |
| YOM              | 2024    | Mileage      | 7,339             |
| Registration No. | NFR9252 | Chassis No.  | PA1B18F31R4255787 |
| CC               | 1.3     | Transmission | CVT               |
| Fuel Type        | Gas     | Type of Body | Sedan             |
| Colour           | Blue    |              |                   |

## Body / Panel Condition



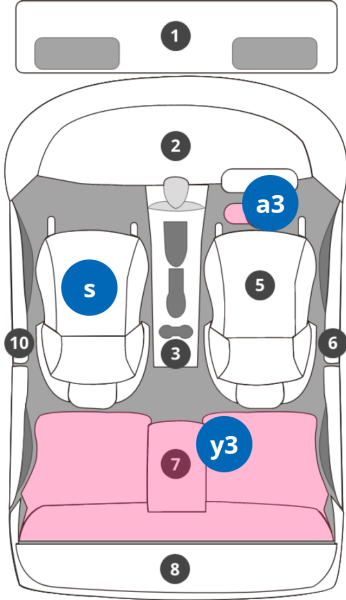
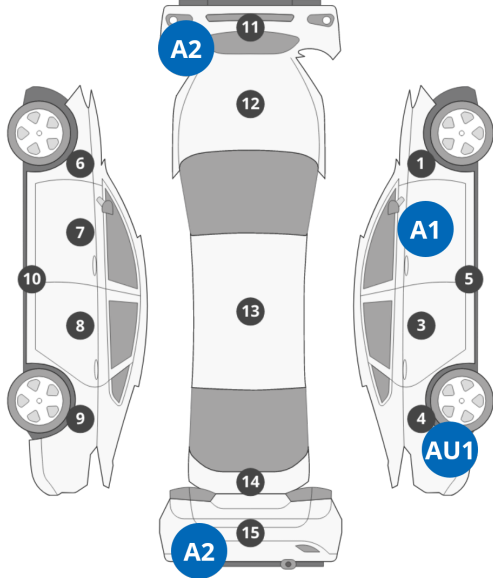
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 132.3         | 136    | 132    | 129      |
| 2  | Boot Lid           | 129.3         | 123    | 133    | 132      |
| 3  | Roof               | 121.0         | 118    | 122    | 118/126  |
| 4  | Left Front Fender  | 125.0         | 133    | 123    | 119      |
| 5  | Left Front Door    | 125.3         | 136    | 118    | 122      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 139.3         | 128    | 139    | 151      |
| 8  | Left Back Panel    | 131.3         | 138    | 135    | 121      |
| 9  | Right Front Fender | 121.0         | 119    | 123    | 121      |
| 10 | Right Front Door   | 122.6         | 125    | 121    | 122      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 128.6         | 114    | 132    | 140      |
| 13 | Right Back Panel   | 135.0         | 136    | 125    | 144      |

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| Interior Evaluation : <span style="color: red;">B</span>                                                                                                                                                                                          | Exterior Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                                                |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p> |
| <b>Remarks</b><br>Overall Interior - Smell - Yes / (L) Front Floor Mat - Cut, Crack - Medium / Rear Seat - Grime - Medium                                                                                                                         | <b>Remarks</b><br>(L) Front Door - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal                                                                                            |
| Frame Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                             | Functional Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                                              |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                               | <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                     |

## Inspector Notes

swirl marks and hairline scratches around the exterior,/ with rain visor/