

General Information

Date & Time: 10, Jul, 2025 15:53

Make	Toyota	Model	Camry
YOM	2019	Odo Meter Reading	35,257
Registration No.	NCL3427	Chassis No.	ME2BF3HK9K4003336
CC	2.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



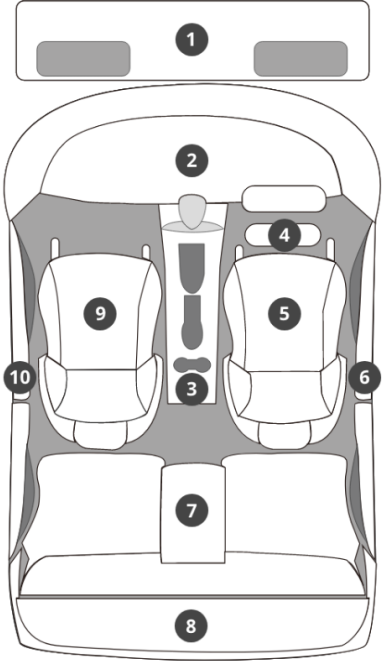
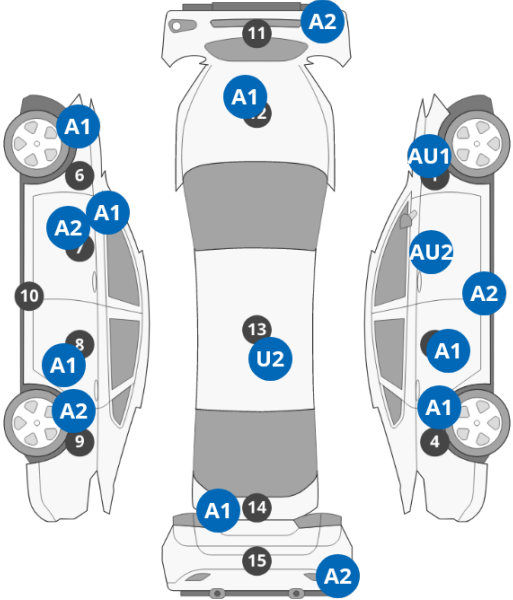
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	111	106	113
2	Boot Lid	107.6	107	117	99
3	Roof	121.0	125	115	112/132
4	Left Front Fender	175.6	180	176	171
5	Left Front Door	110.6	107	114	111
6	Center Panel Left				
7	Left Rear Door	110.3	112	101	118
8	Left Back Panel	122.0	135	110	121
9	Right Front Fender	122.0	116	127	123
10	Right Front Door	114.3	120	112	111
11	Center Panel Right				
12	Right Rear Door	114.6	117	107	120
13	Right Back Panel	127.0	130	116	135

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate</p>