

## General Information

Date & Time: 09, Nov, 2024 15:42

|                  |         |              |                   |
|------------------|---------|--------------|-------------------|
| Make             | Toyota  | Model        | Vios              |
| YOM              | 2021    | Mileage      | 23,359            |
| Registration No. | NET7280 | Chassis No.  | PA1B18F39M4155297 |
| CC               | 1.3     | Transmission | CVT               |
| Fuel Type        | Gas     | Type of Body | Sedan             |
| Colour           | Black   |              |                   |

## Body / Panel Condition



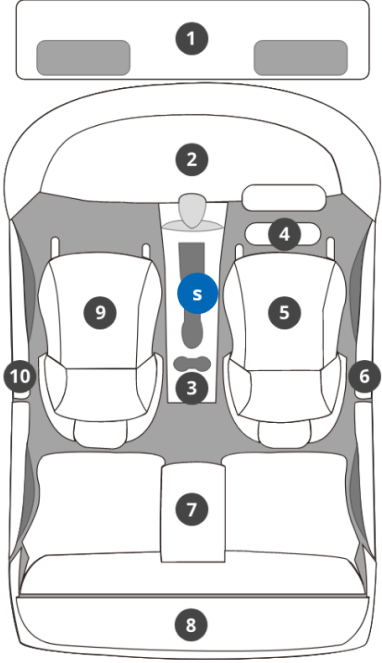
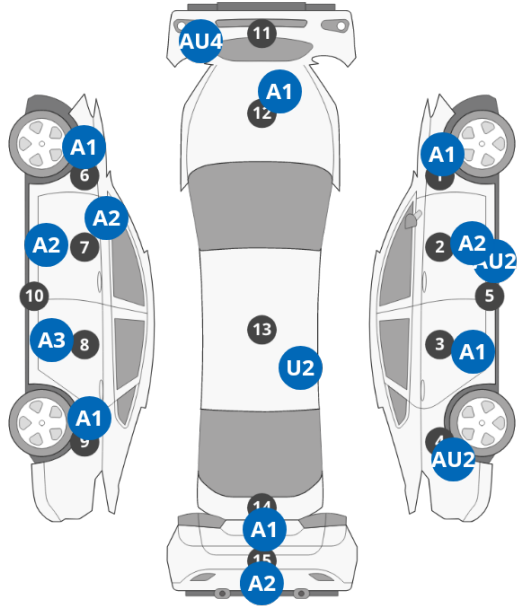
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 124.3         | 119    | 123    | 131      |
| 2  | Boot Lid           | 119.6         | 115    | 117    | 127      |
| 3  | Roof               | 119.7         | 131    | 119    | 117/112  |
| 4  | Left Front Fender  | 114.3         | 119    | 109    | 115      |
| 5  | Left Front Door    | 116.0         | 121    | 115    | 112      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 120.0         | 117    | 120    | 123      |
| 8  | Left Back Panel    | 129.3         | 139    | 122    | 127      |
| 9  | Right Front Fender | 107.6         | 111    | 105    | 107      |
| 10 | Right Front Door   | 116.6         | 116    | 115    | 119      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 118.0         | 112    | 114    | 128      |
| 13 | Right Back Panel   | 126.6         | 123    | 130    | 127      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                     | Exterior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                           |
| <p><b>Remarks</b><br/>Overall Interior - Smell - Yes</p>                                                                                                                                                                                           | <p><b>Remarks</b><br/>Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small</p> |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                        | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <p><b>Remarks</b><br/>Defects not found</p>                                                                                                                                                                                                        | <p><b>Remarks</b><br/>Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |

| Inspector Notes                                                                        |
|----------------------------------------------------------------------------------------|
| no reverse camera/hairline scratches/ no spare tire/with jack& tools&warranty booklets |