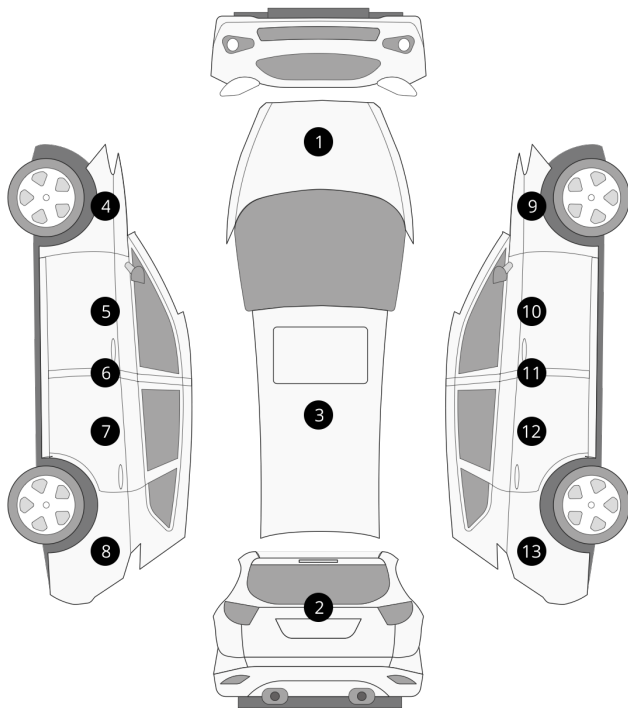


General Information

Date & Time: 09, Jul, 2025 13:25

Make	Suzuki	Model	Swift
YOM	2024	Odo Meter Reading	11,697
Registration No.	NKL5293	Chassis No.	MMSZC63S8RR100106
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



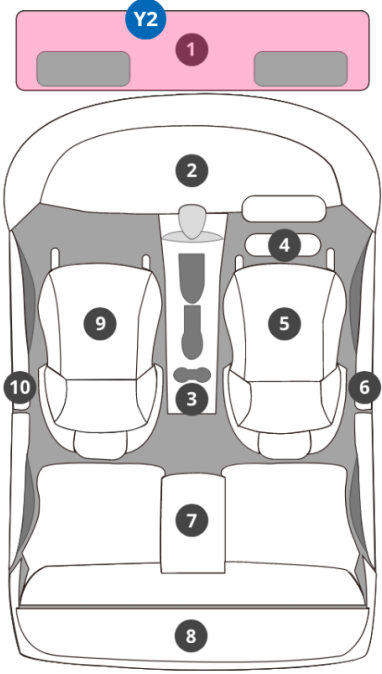
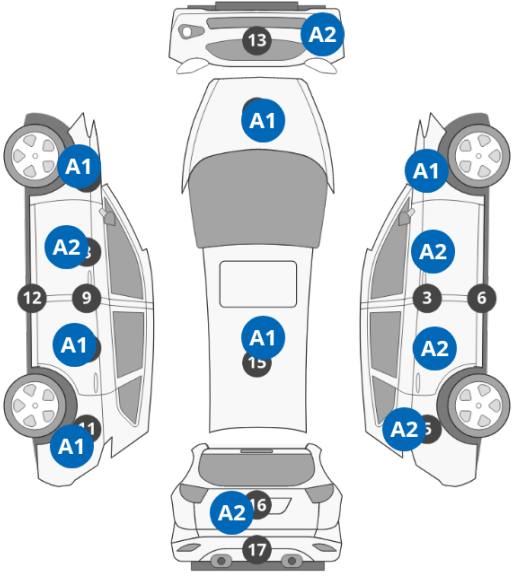
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	106	123	106
2	Boot Lid	129.0	126	126	135
3	Roof	121.7	117	113	135/122
4	Left Front Fender	113.0	107	114	118
5	Left Front Door	118.0	125	112	117
6	Center Panel Left				
7	Left Rear Door	127.0	120	147	114
8	Left Back Panel	123.6	129	124	118
9	Right Front Fender	107.0	105	107	109
10	Right Front Door	110.3	109	109	113
11	Center Panel Right				
12	Right Rear Door	117.6	114	114	125
13	Right Back Panel	119.0	122	115	120

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small	Remarks Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With warranty booklet and LTO plate, Jack and Sparetire, Tools. scratch headlight and tail light.