

General Information

Date & Time: 16, Jul, 2025 14:46

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	24,877
Registration No.	CAW6934	Chassis No.	PA1B18F34M4164375
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



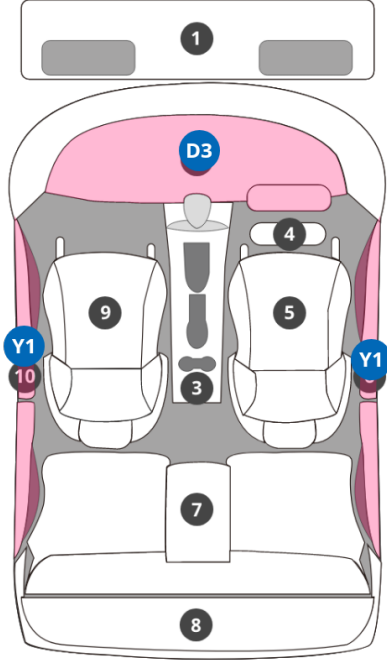
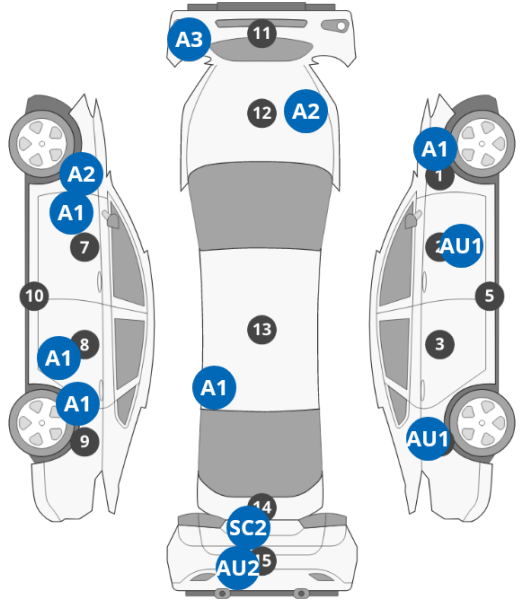
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.4	101	95	111
2	Boot Lid	103.1	103	95	111
3	Roof	96.7	102	91	102/92
4	Left Front Fender	92.1	90	90	96
5	Left Front Door	98.7	102	94	100
6	Center Panel Left				
7	Left Rear Door	94.5	100	97	87
8	Left Back Panel	108.6	101	125	100
9	Right Front Fender	87.0	91	82	88
10	Right Front Door	96.5	91	94	104
11	Center Panel Right				
12	Right Rear Door	88.4	85	87	93
13	Right Back Panel	96.5	92	95	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Instrument Panel - Loose, Deformed - Medium / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Rust, Corrosion - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Overall Exterior - Worn as per age - Yes
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack, no tools, with spare tire, abnormal noise on engine, weak battery, panel guage issue, weak air conditioner