

General Information

Date & Time: 16, Jul, 2025 13:20

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	94,289
Registration No.	NER8696	Chassis No.	PA1B18F31N4170815
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



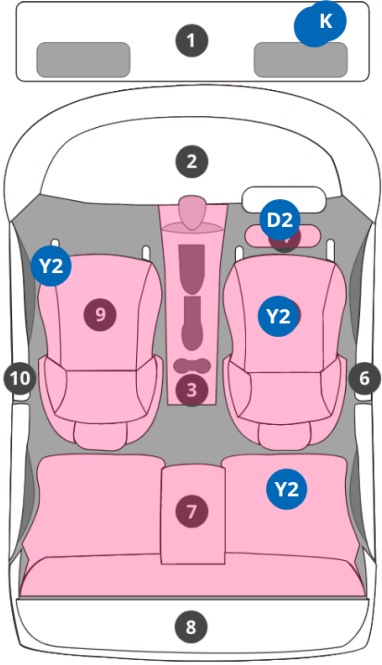
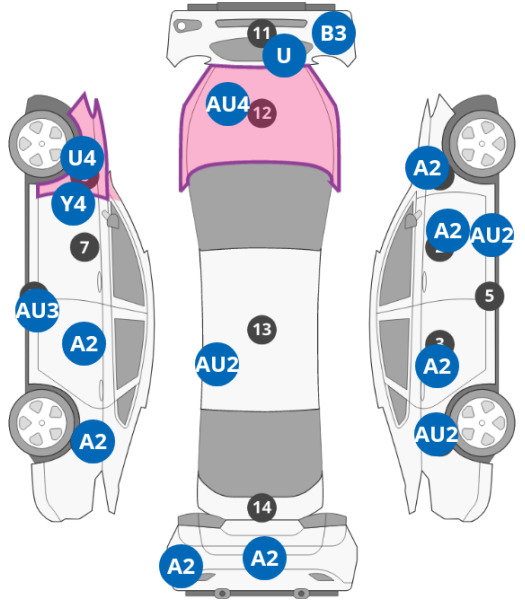
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	114	107	123
2	Boot Lid	101.8	100	102	104
3	Roof	90.0	95	83	89/93
4	Left Front Fender	96.9	102	97	92
5	Left Front Door	103.2	109	104	97
6	Center Panel Left				
7	Left Rear Door	100.6	99	98	105
8	Left Back Panel	103.3	109	101	100
9	Right Front Fender	144.0	138	133	161
10	Right Front Door	102.3	97	94	116
11	Center Panel Right				
12	Right Rear Door	96.6	97	95	98
13	Right Back Panel	102.4	101	97	109

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Worn as per age - Yes / Room Mirror - Missing - Yes	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Dent - Large / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Modified - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Spare tire. no warranty booklet and Tools, Crack and scratch headlight and tail light. partially missing front bumper parts, fog light assembly missing, tow hook cover missing, possible flooded, worn tires, adhesive marks on side mirror, vehicle is not moving.