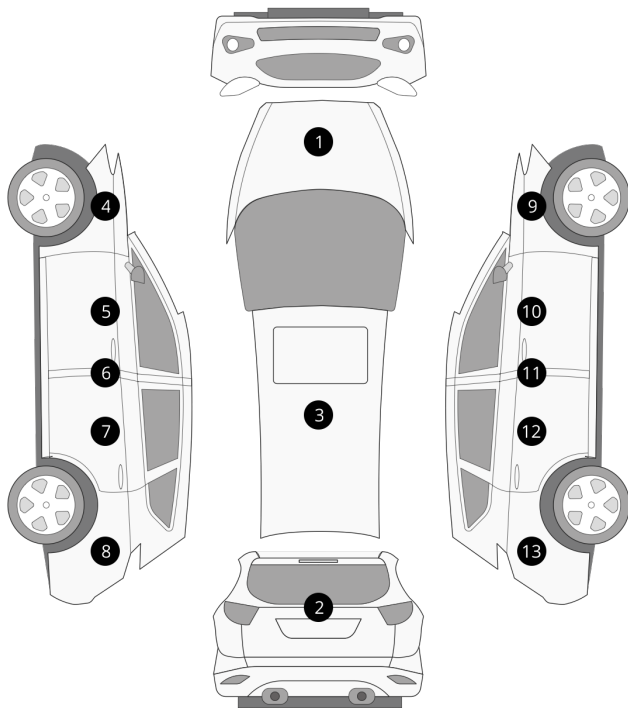


General Information

Date & Time: 11, Jul, 2025 13:03

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	75,362
Registration No.	NIL3175	Chassis No.	PA1B18F33P4205471
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



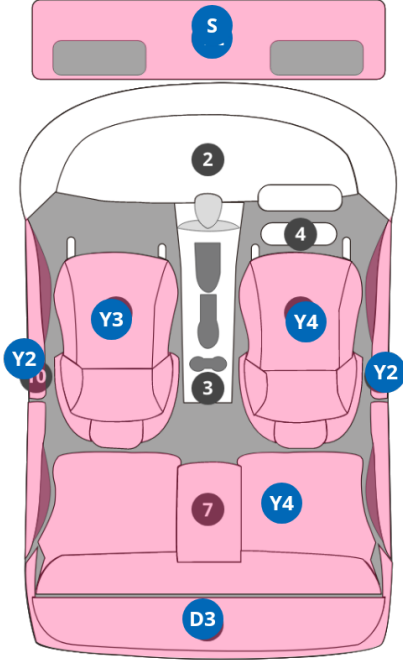
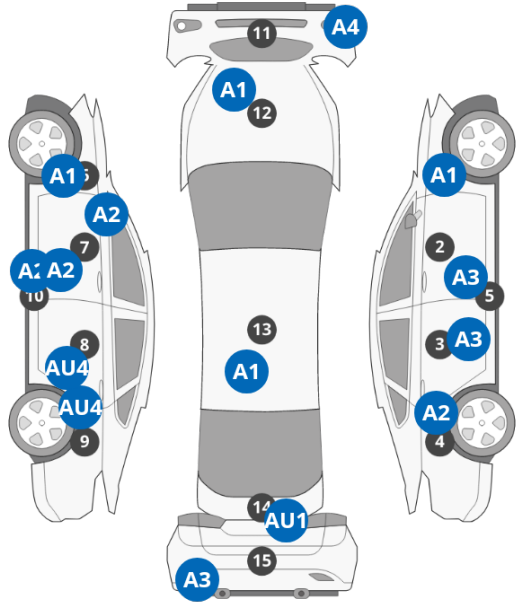
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.3	132	127	132
2	Boot Lid	130.3	132	123	136
3	Roof	112.5	120	114	106/110
4	Left Front Fender	111.3	113	106	115
5	Left Front Door	121.6	121	121	123
6	Center Panel Left				
7	Left Rear Door	117.0	122	114	115
8	Left Back Panel	121.3	132	114	118
9	Right Front Fender	112.6	111	115	112
10	Right Front Door	115.0	113	113	119
11	Center Panel Right				
12	Right Rear Door	113.3	105	116	119
13	Right Back Panel	115.0	116	112	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Loose, Deformed - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Horn - Issue - Yes

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, possible flooded