

General Information

Date & Time: 11, Nov, 2024 14:57

Make	Toyota	Model	Vios
YOM	2024	Mileage	10,125
Registration No.	CCA7666	Chassis No.	PA1B18F38R4254233
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



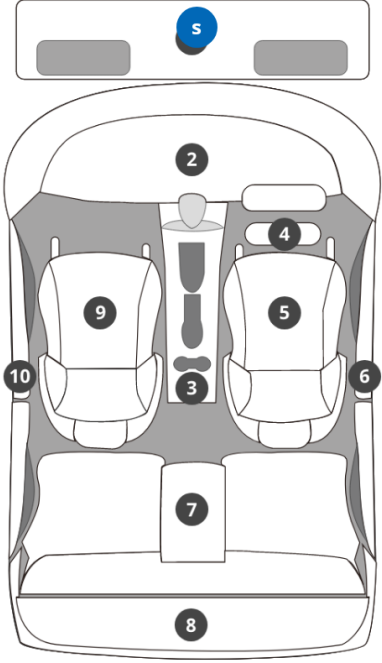
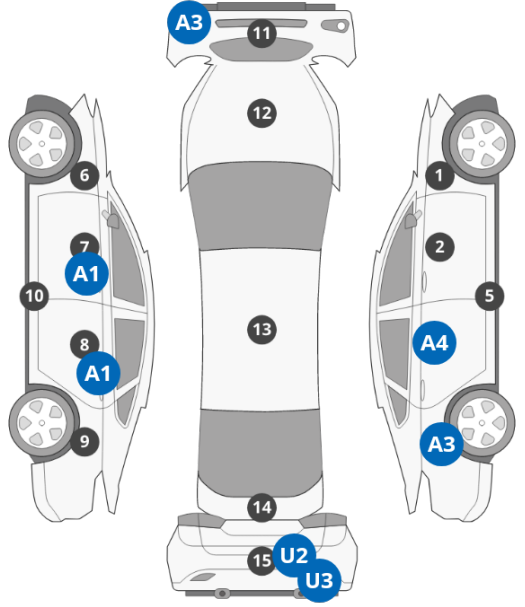
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.0	129	118	137
2	Boot Lid	125.6	125	126	126
3	Roof	125.7	139	123	116/125
4	Left Front Fender	109.0	112	113	102
5	Left Front Door	107.3	109	106	107
6	Center Panel Left				
7	Left Rear Door	115.0	123	117	105
8	Left Back Panel	125.6	132	128	117
9	Right Front Fender	115.6	116	116	115
10	Right Front Door	114.0	115	115	112
11	Center Panel Right				
12	Right Rear Door	114.6	110	116	118
13	Right Back Panel	124.0	116	123	133

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
swirlmarks and hairline scratches around the exterior. With Warranty booklet and user manual. Low washer fluid level.