


General Information

Date & Time: 14, Jul, 2025 09:48

Make	Toyota	Model	Fortuner
YOM	2017	Odo Meter Reading	223,606
Registration No.	NAD1149	Chassis No.	MHFJB8GS3G1519993
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition

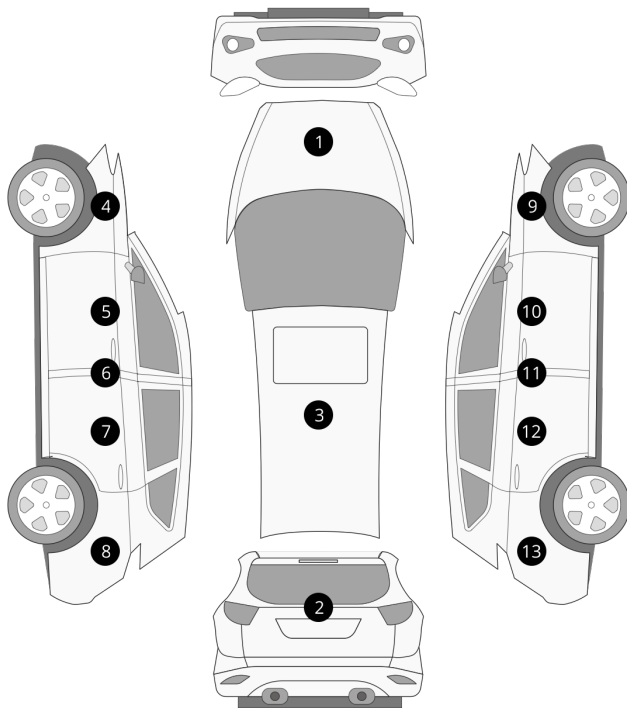

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.0	125	129	124
2	Boot Lid	408.6	211	306	709
3	Roof	131.7	132	140	122/133
4	Left Front Fender	177.0	187	176	168
5	Left Front Door	132.0	136	135	125
6	Center Panel Left				
7	Left Rear Door	209.6	185	199	245
8	Left Back Panel	188.0	209	178	177
9	Right Front Fender	121.0	129	114	120
10	Right Front Door	184.6	209	175	170
11	Center Panel Right				
12	Right Rear Door	308.6	294	373	259
13	Right Back Panel	356.6	349	352	369

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Large / Ceiling - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Large / (R) Front Seat - Grime - Minimal / Console, Switchs, Vents - Loose, Deformed - Medium / (L) Front Floor Mat - Worked - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / Overall Exterior - Full Re-Paint in same color - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, busted reverse light and plate light, scratches on headlight and tail light