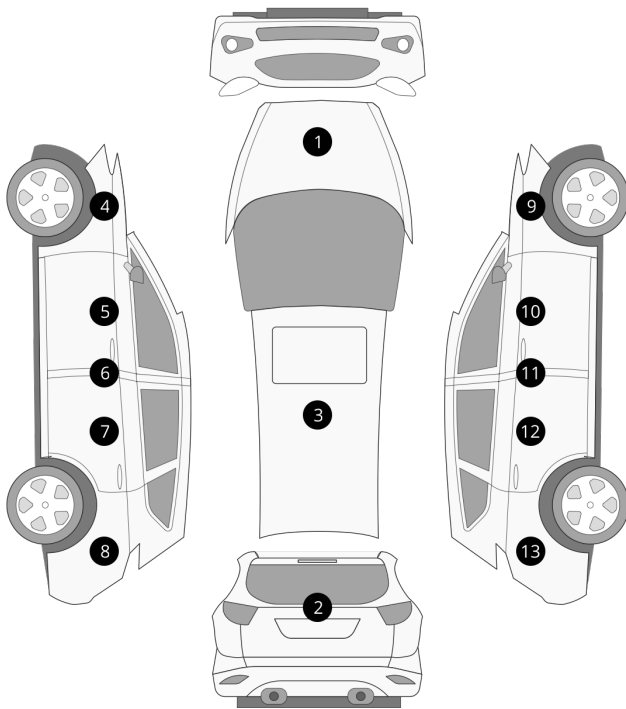


General Information

Date & Time: 11, Jul, 2025 15:52

Make	MG	Model	ZS
YOM	2023	Odo Meter Reading	13,689
Registration No.	NKA9796	Chassis No.	LSJW74U98PZ068587
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



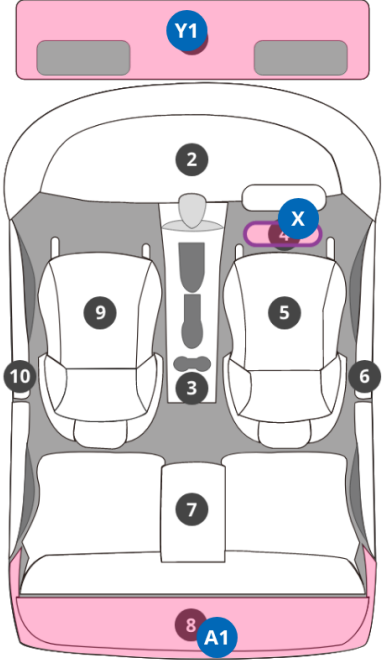
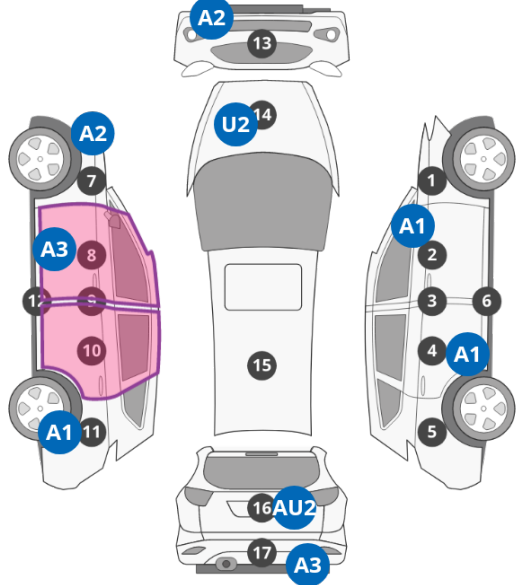
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.3	139	138	135
2	Boot Lid	155.6	144	182	141
3	Roof	130.5	118	131	135/138
4	Left Front Fender	139.0	128	145	144
5	Left Front Door	179.6	143	159	237
6	Center Panel Left				
7	Left Rear Door	184.6	185	175	194
8	Left Back Panel	143.0	153	136	140
9	Right Front Fender	140.0	144	147	129
10	Right Front Door	150.3	145	138	168
11	Center Panel Right				
12	Right Rear Door	140.3	141	134	146
13	Right Back Panel	141.3	138	142	144

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Minimal	Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
No LTO plate/With spare tire/with warranty booklet/With jack and tools