

General Information

Date & Time: 14, Jul, 2025 10:55

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,673
Registration No.	DBJ8841	Chassis No.	PA1B18F34P4226488
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



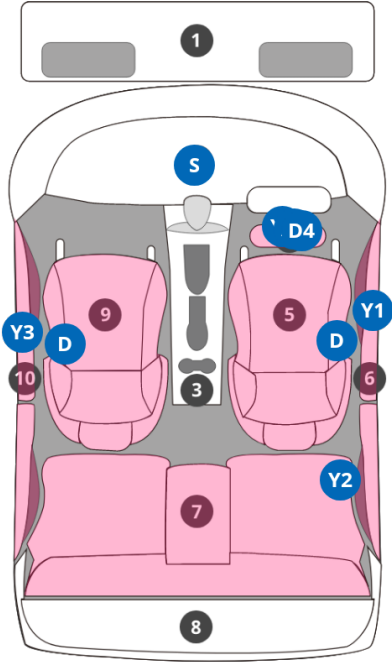
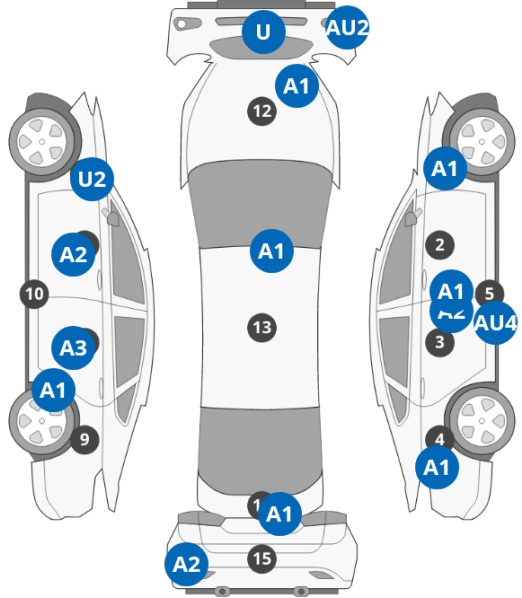
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.6	148	127	150
2	Boot Lid	126.0	123	127	128
3	Roof	126.2	133	123	124/125
4	Left Front Fender	123.6	128	116	127
5	Left Front Door	133.0	131	127	141
6	Center Panel Left				
7	Left Rear Door	137.6	149	140	124
8	Left Back Panel	135.3	150	128	128
9	Right Front Fender	124.0	124	124	124
10	Right Front Door	112.3	116	110	111
11	Center Panel Right				
12	Right Rear Door	126.6	126	121	133
13	Right Back Panel	133.0	128	133	138

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Mat Other - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail, possible flooding, worn tires