

General Information

Date & Time: 14, Jul, 2025 10:40

Make	Mitsubishi	Model	Strada
YOM	2019	Odo Meter Reading	50,874
Registration No.	DAL8043	Chassis No.	MMBJLKK10KH031983
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



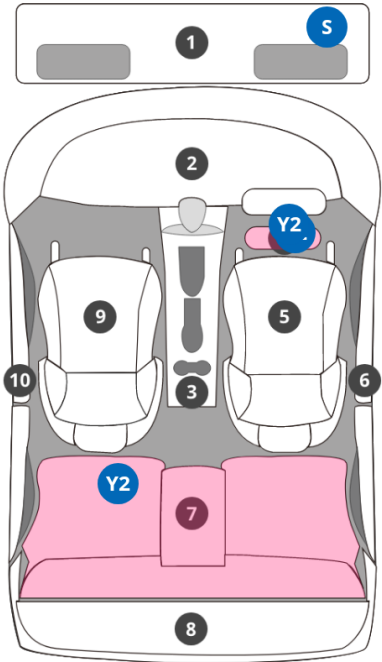
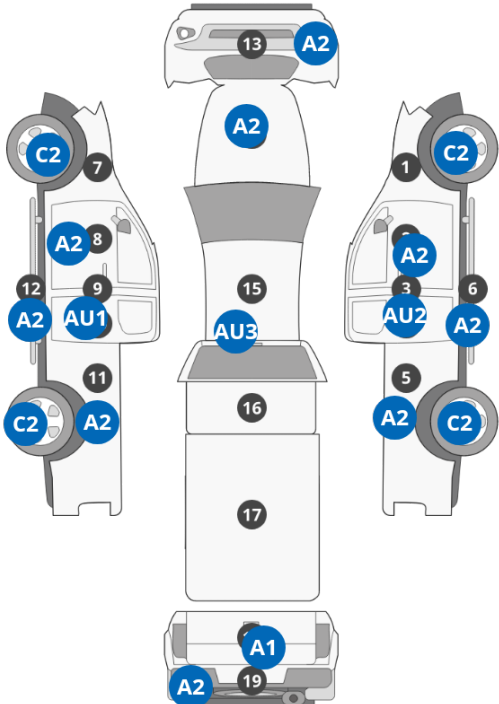
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	123	130	129
2	Boot Lid	99.6	100	100	100
3	Roof	102.9	95	97	123/97
4	Left Front Fender	97.8	95	97	102
5	Left Front Door	108.3	114	109	102
6	Center Panel Left				
7	Left Rear Door	98.4	100	95	101
8	Left Back Panel	104.0	102	100	110
9	Right Front Fender	105.3	113	101	102
10	Right Front Door	109.6	111	111	107
11	Center Panel Right				
12	Right Rear Door	101.4	96	100	109
13	Right Back Panel	89.7	93	83	94

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes	Remarks (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / Roof - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, Jack, Incomplete Tools. no warranty booklet and worn aftermarket wheels. scratch headlight and tail light. I