

General Information

Date & Time: 11, Jul, 2025 15:57

Make	Honda	Model	City
YOM	2017	Odo Meter Reading	80,362
Registration No.	NDD7324	Chassis No.	PADGM6630HV310218
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Brown		

Body / Panel Condition



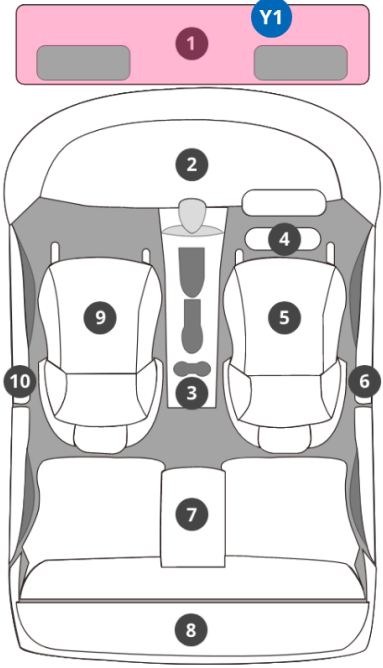
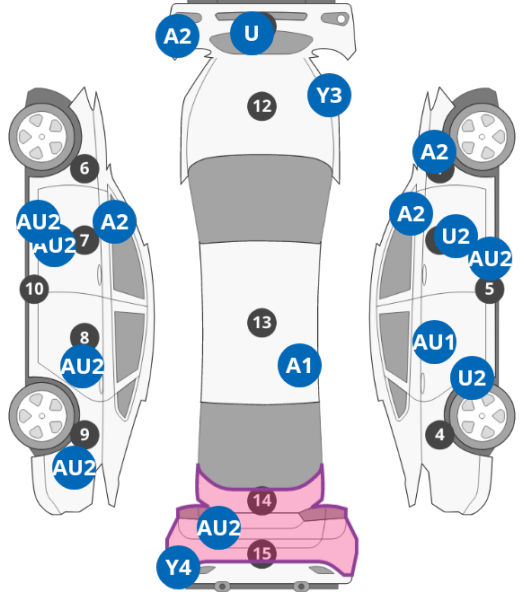
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	300.6	284	308	310
2	Boot Lid	95.8	103	68	117
3	Roof	92.4	87	96	88/100
4	Left Front Fender	141.3	151	149	124
5	Left Front Door	89.9	88	93	89
6	Center Panel Left				
7	Left Rear Door	97.2	120	83	89
8	Left Back Panel	120.3	126	107	128
9	Right Front Fender	174.0	168	179	175
10	Right Front Door	82.5	86	74	88
11	Center Panel Right				
12	Right Rear Door	95.7	79	88	121
13	Right Back Panel	88.5	90	76	100

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes</p>	<p>Remarks Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, reverse and park light issue</p>