

General Information

Date & Time: 14, Jul, 2025 12:59

Make	Mitsubishi	Model	Mirage
YOM	2018	Odo Meter Reading	63,845
Registration No.	NBS8220	Chassis No.	PAEA13TJJA006916
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



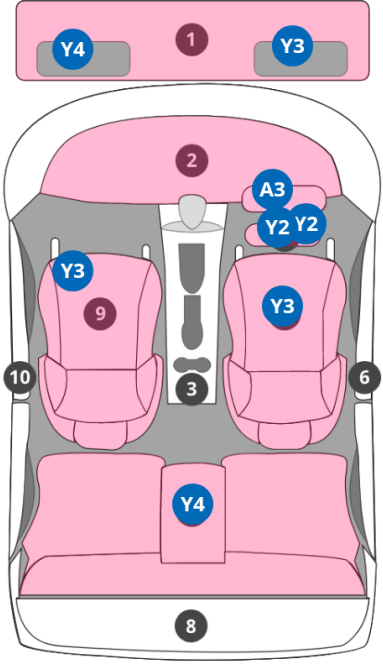
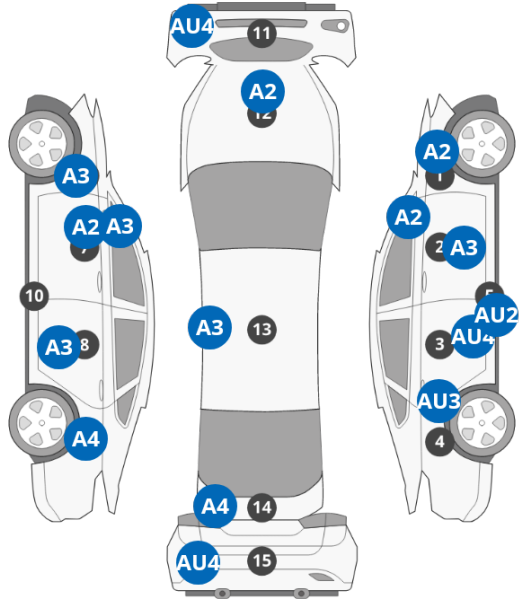
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	105	111	101
2	Boot Lid	68.1	71	68	66
3	Roof	90.8	100	89	82/92
4	Left Front Fender	237.3	281	270	161
5	Left Front Door	98.5	100	100	96
6	Center Panel Left				
7	Left Rear Door	100.8	107	98	98
8	Left Back Panel	102.9	99	83	127
9	Right Front Fender	101.6	101	102	102
10	Right Front Door	105.6	103	105	109
11	Center Panel Right				
12	Right Rear Door	142.3	141	133	153
13	Right Back Panel	100.1	101	98	101

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Medium</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Maintenance warning lamp. Aircon issue. Gap at front bumper,bonnet,rear bumper and taillight. scratches on headlight and taillight. Drivebelt noise issue. Without warranty booklet,jack and tools. With spare tire. 1 key. With LTO plate. rear view mirror loose.</p>