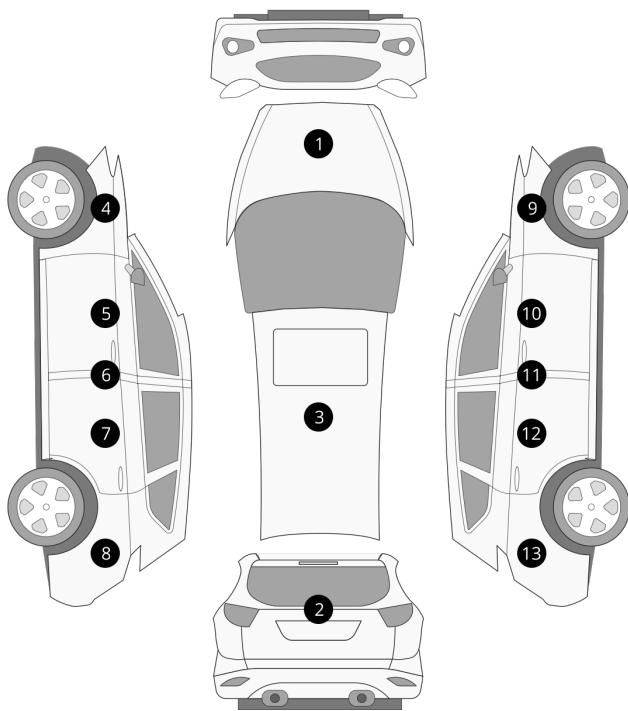


General Information

Date & Time: 14, Jul, 2025 14:50

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	13,112
Registration No.	DBR2801	Chassis No.	MHKAA1BC4RJ026872
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



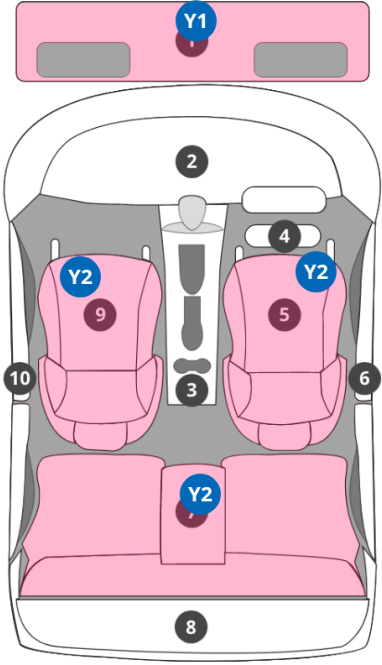
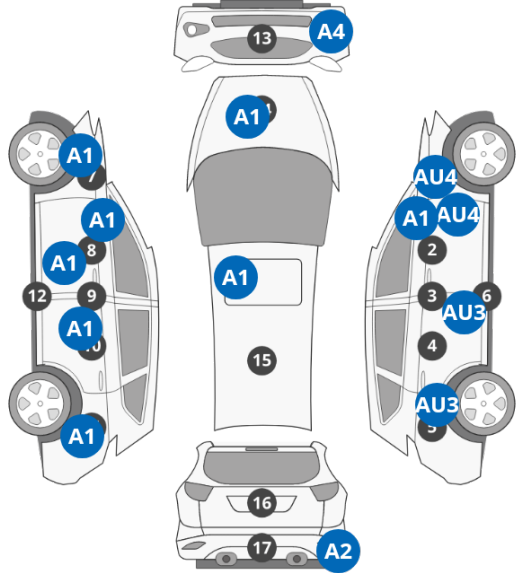
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	127	122	118
2	Boot Lid	96.8	97	105	88
3	Roof	89.6	88	94	88/88
4	Left Front Fender	116.0	120	104	124
5	Left Front Door	121.3	119	116	129
6	Center Panel Left				
7	Left Rear Door	120.6	124	115	123
8	Left Back Panel	96.2	98	101	90
9	Right Front Fender	115.0	130	106	109
10	Right Front Door	124.3	127	121	125
11	Center Panel Right				
12	Right Rear Door	117.0	111	114	126
13	Right Back Panel	108.0	118	104	102

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, maintenance lamp on