

General Information

Date & Time: 11, Nov, 2024 12:48

Make	Toyota	Model	Avanza
YOM	2023	Mileage	10,054
Registration No.	NIN7679	Chassis No.	MHFAA1BY5P0013710
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



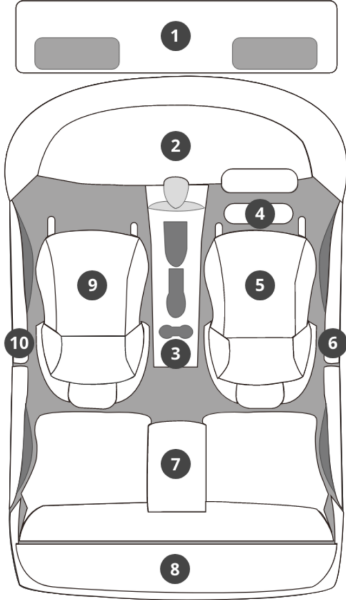
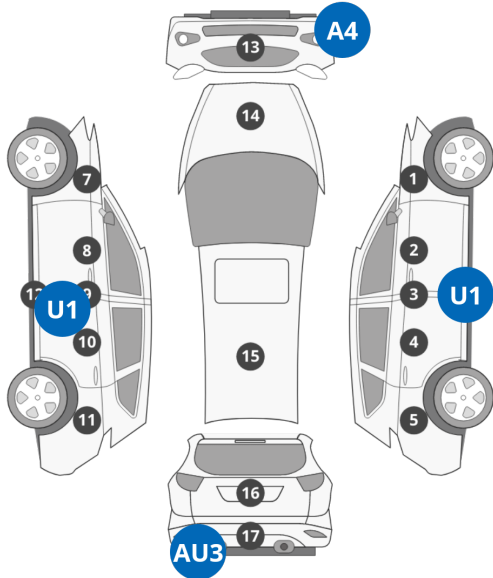
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	143.3	151	126	153
2	Boot Lid	147.0	162	154	125
3	Roof	143.2	148	145	131/149
4	Left Front Fender	140.0	125	169	126
5	Left Front Door	146.6	155	140	145
6	Center Panel Left				
7	Left Rear Door	145.3	154	135	147
8	Left Back Panel	151.3	152	143	159
9	Right Front Fender	145.0	135	182	118
10	Right Front Door	140.3	139	144	138
11	Center Panel Right				
12	Right Rear Door	138.0	144	128	142
13	Right Back Panel	145.3	145	142	149

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Door, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Door, Molding - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with tools and spare tire/ swirl marks and hairline scratches present on the exterior