

General Information

Date & Time: 16, Jul, 2025 09:45

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	89,435
Registration No.	NEP4255	Chassis No.	PA1B18F31M4139000
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



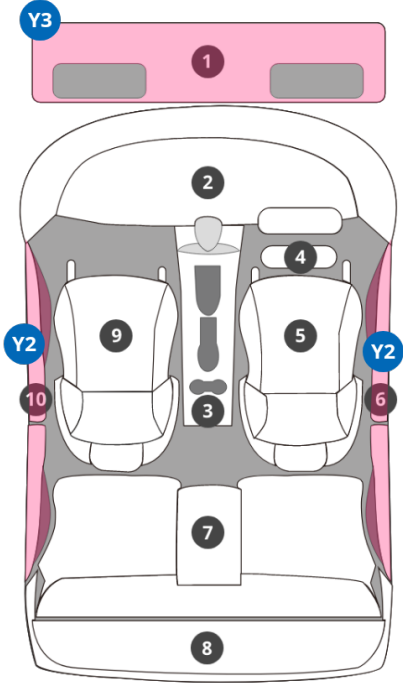
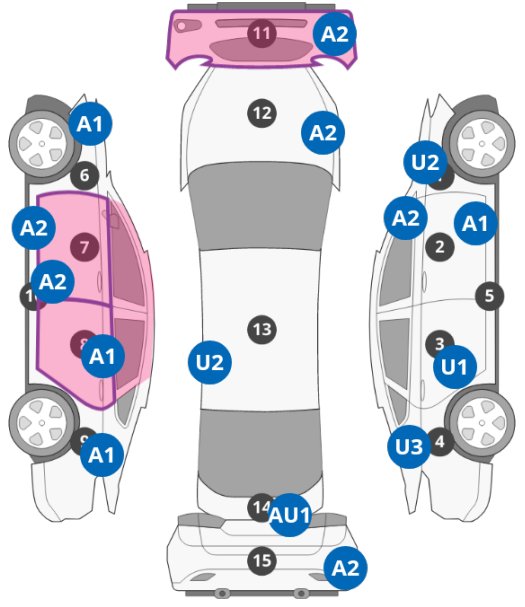
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	166.3	165	180	154
2	Boot Lid	100.5	97	100	105
3	Roof	86.6	89	88	82/88
4	Left Front Fender	132.3	145	139	113
5	Left Front Door	123.6	116	129	126
6	Center Panel Left				
7	Left Rear Door	134.3	154	136	113
8	Left Back Panel	142.6	135	152	141
9	Right Front Fender	292.0	394	164	318
10	Right Front Door	170.6	179	181	152
11	Center Panel Right				
12	Right Rear Door	177.0	166	173	192
13	Right Back Panel	167.3	149	167	186

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light