

General Information

Date & Time: 09, Nov, 2024 15:50

Make	Toyota	Model	Hiace
YOM	2023	Mileage	6,447
Registration No.	NEE1219	Chassis No.	JTFNAFAP5N8028068
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



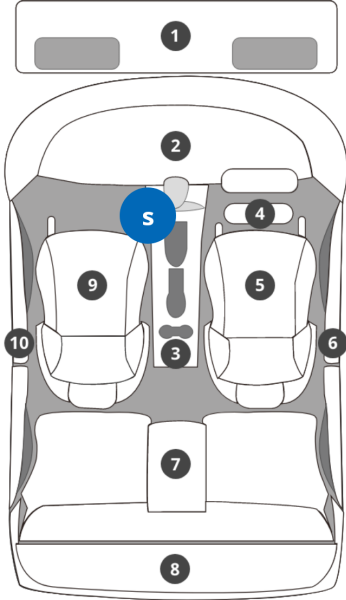
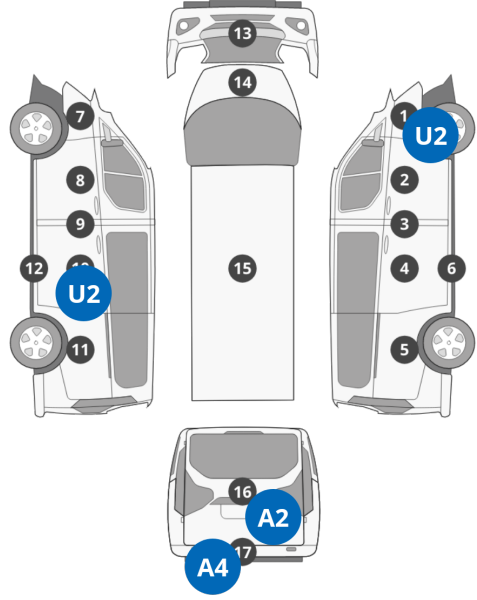
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	103	105	100
2	Boot Lid	92.5	96	92	89
3	Roof	93.0	99	89	93/91
4	Left Front Fender	110.0	111	109	110
5	Left Front Door	103.2	109	98	103
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	100.6	100	98	104
9	Right Front Fender	111.6	107	113	115
10	Right Front Door	100.5	98	101	103
11	Center Panel Right	106.0	101	115	102
12	Right Rear Door	105.1	106	111	98
13	Right Back Panel	105.2	99	110	107

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks Trunk Hood, Rear Gate - Scratch - Small / (R) Front Fender, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
swirl marks and hairline scratches present around the exterior/ no tools, jack, and warranty booklet/ no reverse camera feature