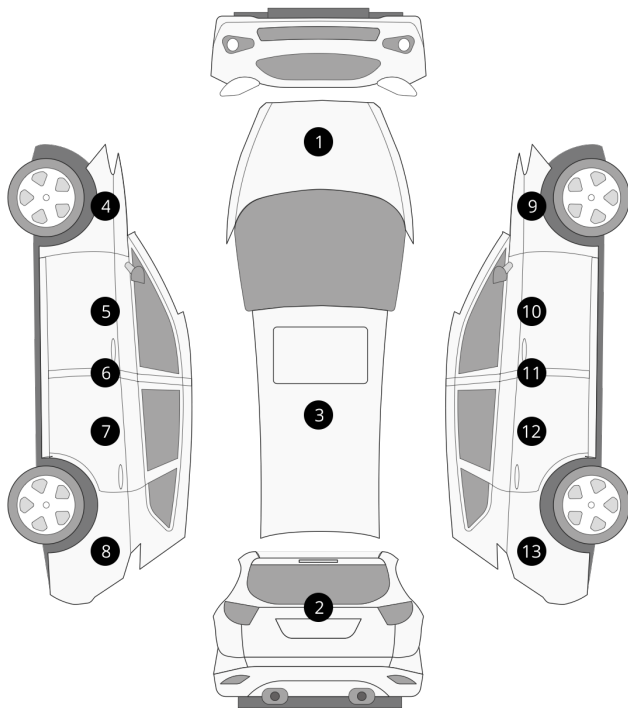


General Information

Date & Time: 21, Jul, 2025 08:11

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,296
Registration No.	CCA8004	Chassis No.	PA1B18F37R4257415
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



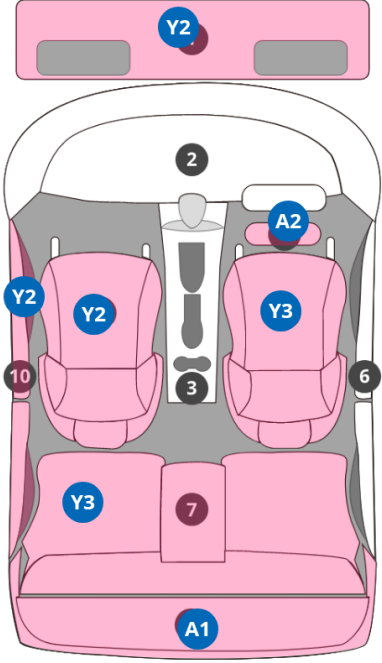
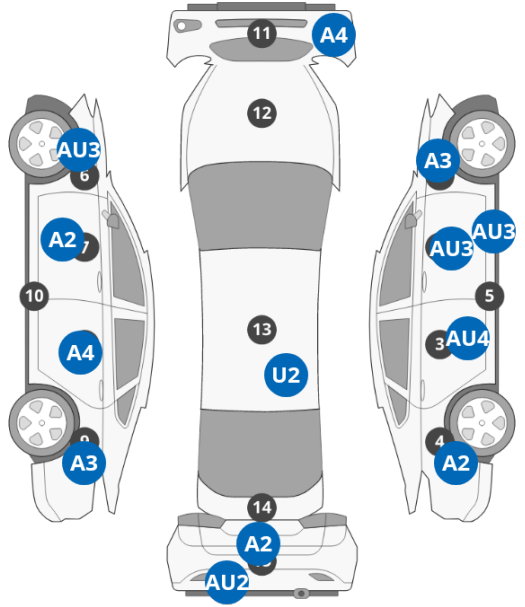
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	102	108	102
2	Boot Lid	93.3	89	92	99
3	Roof	87.0	88	92	80/89
4	Left Front Fender	88.8	89	90	88
5	Left Front Door	90.2	93	87	90
6	Center Panel Left				
7	Left Rear Door	92.3	103	91	83
8	Left Back Panel	94.1	100	92	91
9	Right Front Fender	87.5	86	80	96
10	Right Front Door	86.8	88	85	87
11	Center Panel Right				
12	Right Rear Door	95.1	86	91	108
13	Right Back Panel	92.2	84	92	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack No tools/No warranty booklet/