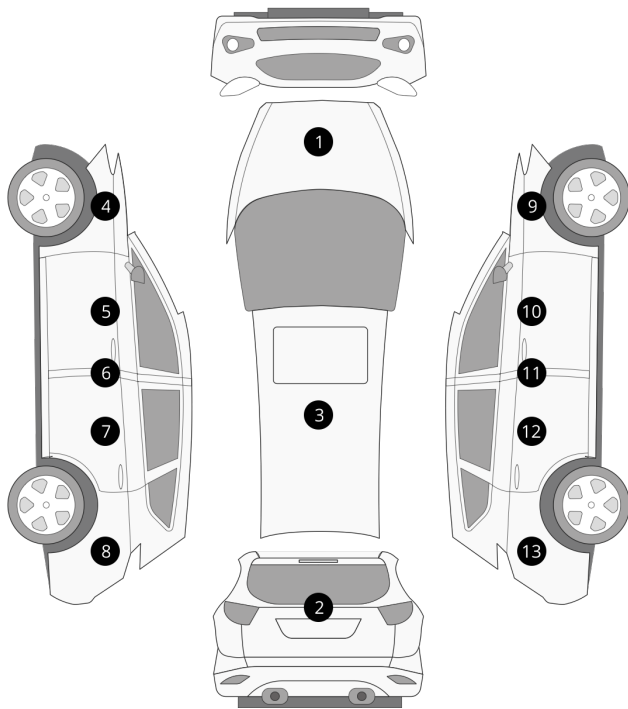


General Information

Date & Time: 21, Jul, 2025 10:18

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,106
Registration No.	DBM6095	Chassis No.	PA1B18F38R4244754
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



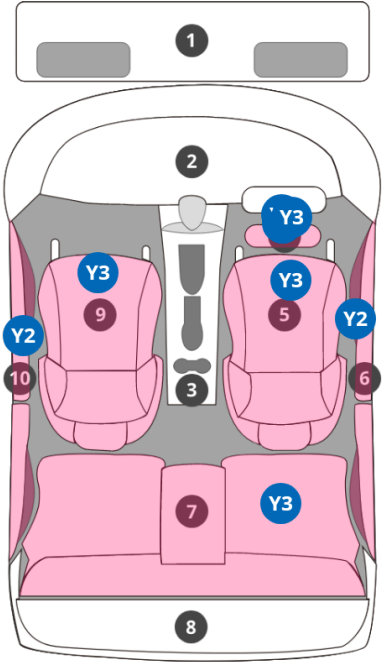
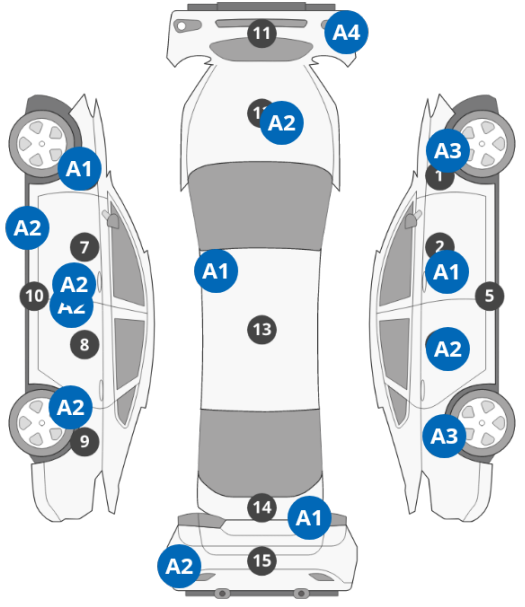
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	102	97	107
2	Boot Lid	100.6	101	102	99
3	Roof	96.9	97	96	101/93
4	Left Front Fender	90.4	89	87	95
5	Left Front Door	93.4	92	93	96
6	Center Panel Left				
7	Left Rear Door	89.3	96	91	82
8	Left Back Panel	100.4	109	100	93
9	Right Front Fender	94.7	97	98	90
10	Right Front Door	93.7	92	96	93
11	Center Panel Right				
12	Right Rear Door	99.0	93	95	109
13	Right Back Panel	93.1	96	84	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, trunk room latch issue