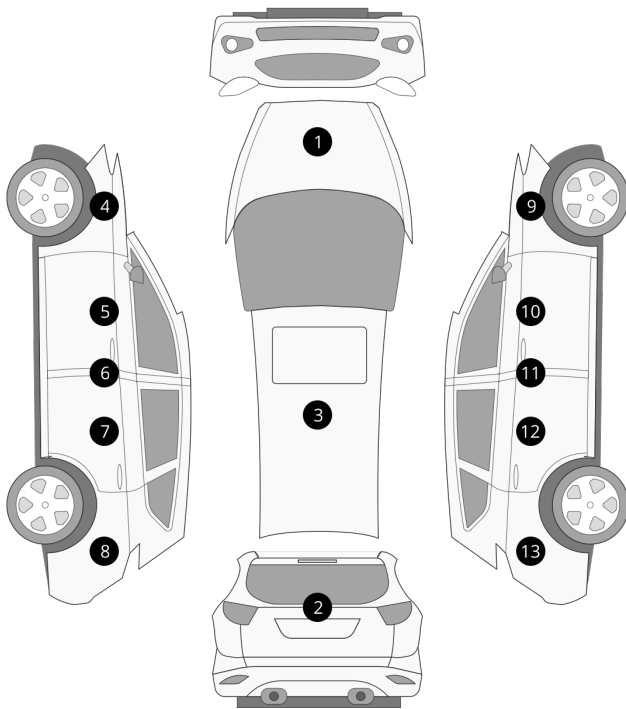


General Information

Date & Time: 22, Jul, 2025 08:59

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	69,558
Registration No.	DBO1716	Chassis No.	PA2JA8EM2P0134658
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



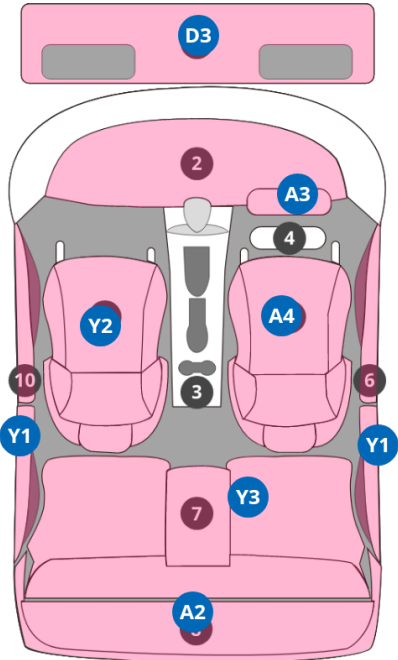
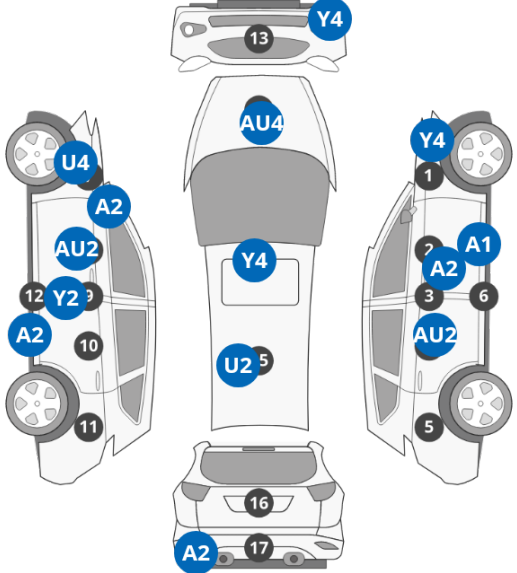
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	119	125	115
2	Boot Lid	94.1	92	96	95
3	Roof	93.0	89	97	90/96
4	Left Front Fender	95.7	86	100	101
5	Left Front Door	96.8	97	97	96
6	Center Panel Left				
7	Left Rear Door	100.2	100	102	99
8	Left Back Panel	99.1	96	99	102
9	Right Front Fender	102.6	101	105	102
10	Right Front Door	101.6	99	102	104
11	Center Panel Right				
12	Right Rear Door	100.9	94	99	110
13	Right Back Panel	107.0	112	108	101

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Cut, Crack - Large / Ceiling - Crinkle - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Crack, Gap - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Large / (R) Front Fender, Molding - Crack, Gap - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / Roof - Dent - Small / Front Windshield - Damaged - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small
Frame Evaluation : D	Functional Evaluation : E
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/with jack and tools/No warranty booklet/left and right door was damage/engine number unable to confirm/windshield damage /right side headlights crack