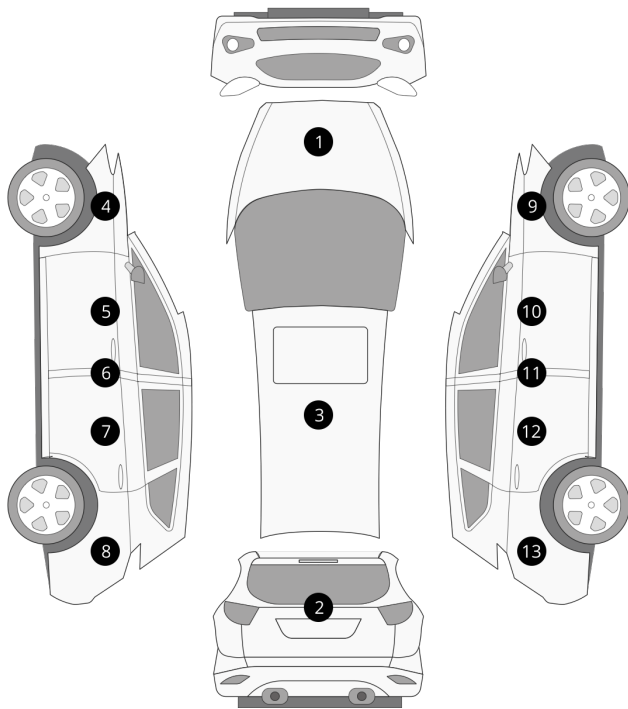


General Information

Date & Time: 21, Jul, 2025 09:22

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	54,879
Registration No.	DBN9730	Chassis No.	PA1B18F34P4237507
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



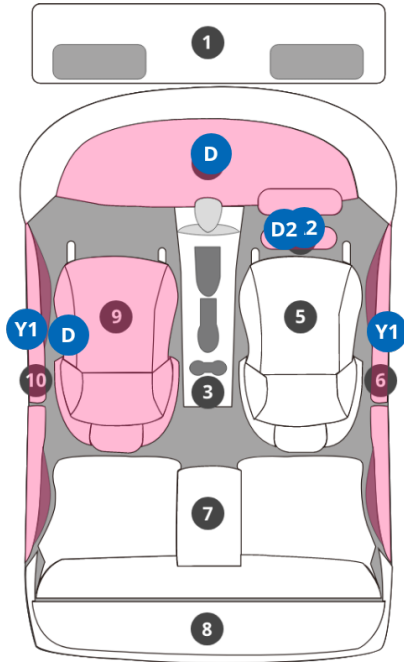
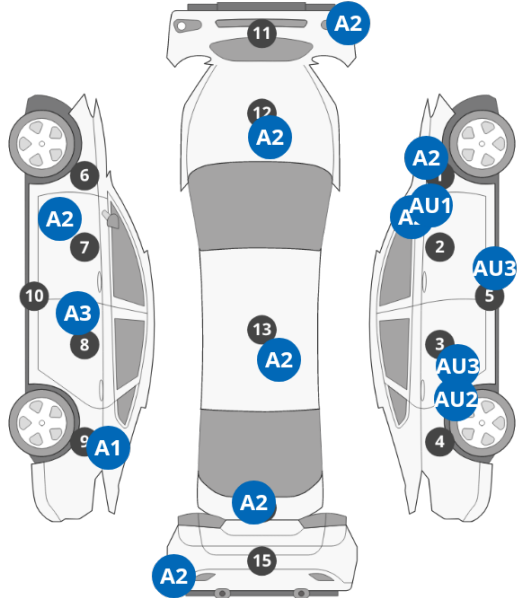
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	103	103	105
2	Boot Lid	94.5	98	88	98
3	Roof	102.6	97	105	96/113
4	Left Front Fender	92.9	94	87	98
5	Left Front Door	94.7	93	90	101
6	Center Panel Left				
7	Left Rear Door	93.5	100	96	85
8	Left Back Panel	98.0	100	102	92
9	Right Front Fender	93.8	89	91	102
10	Right Front Door	96.6	100	94	96
11	Center Panel Right				
12	Right Rear Door	99.5	98	95	106
13	Right Back Panel	98.3	97	101	97

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light