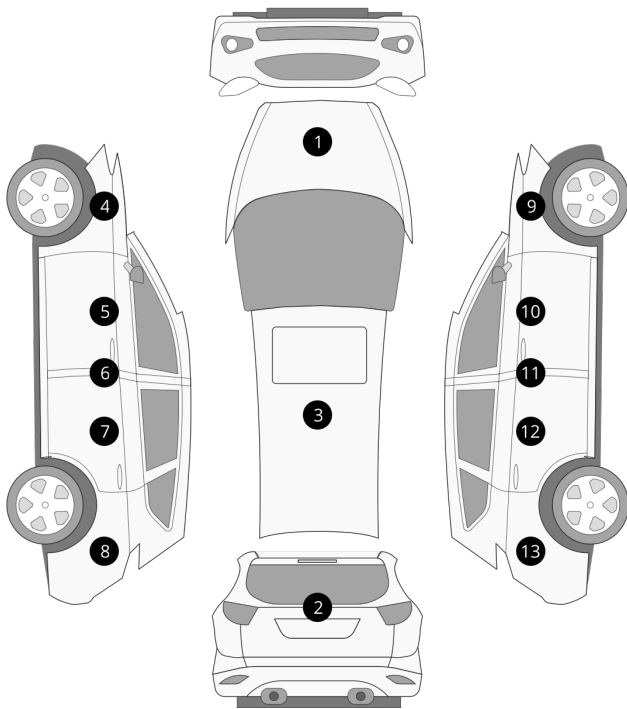


General Information

Date & Time: 18, Jul, 2025 10:35

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	50,441
Registration No.	NIT5465	Chassis No.	PA1B18F34P4231349
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



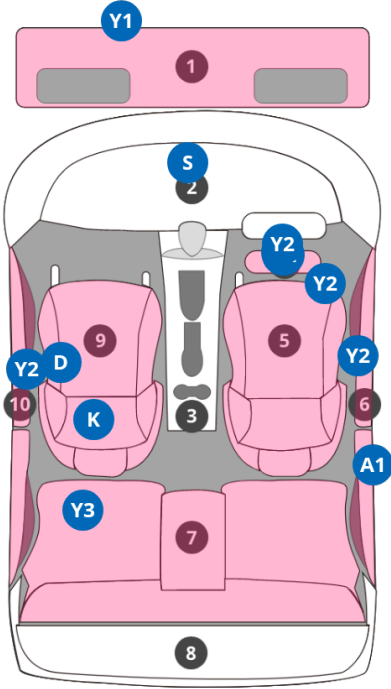
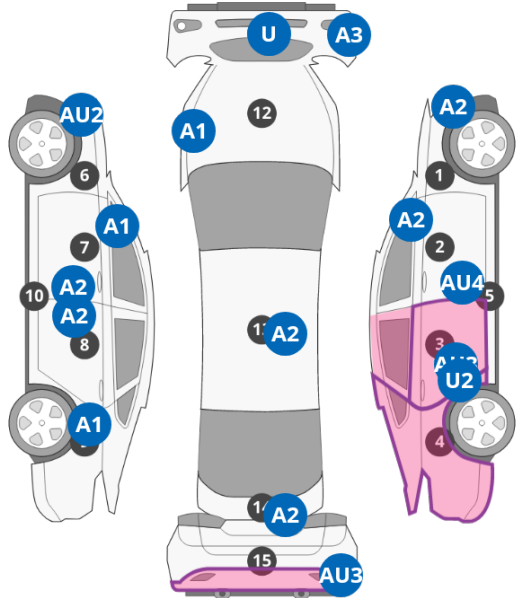
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	116	100	104
2	Boot Lid	95.0	92	96	97
3	Roof	105.9	99	102	98/125
4	Left Front Fender	99.6	103	100	96
5	Left Front Door	96.3	97	97	95
6	Center Panel Left				
7	Left Rear Door	102.6	100	104	104
8	Left Back Panel	97.1	107	90	94
9	Right Front Fender	98.5	98	99	99
10	Right Front Door	102.5	113	100	95
11	Center Panel Right				
12	Right Rear Door	131.6	124	124	147
13	Right Back Panel	223.0	193	232	244

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worn, Scratch, Cut, Crack - Small / Mat Other - Grime - Small / (L) Front Seat - Worn - Yes / Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Small / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, with LTO plate, weak battery, scratches on tail light, cracked tail light