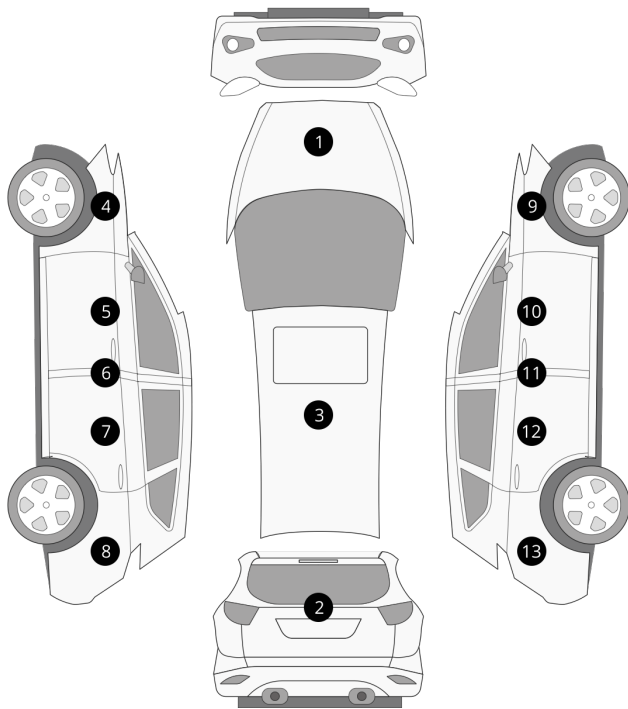


General Information

Date & Time: 22, Jul, 2025 15:27

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	30,842
Registration No.	NIA1131	Chassis No.	PA1B18F31P4217523
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



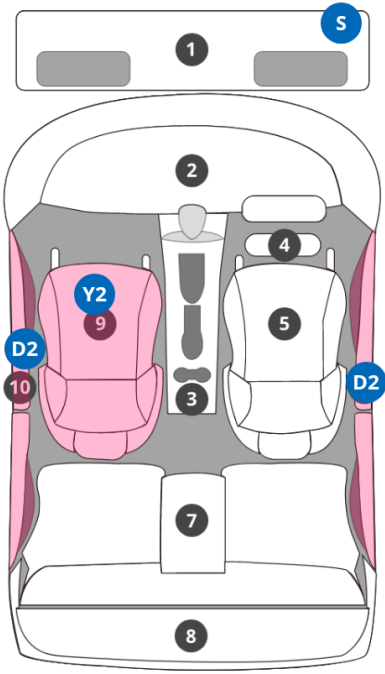
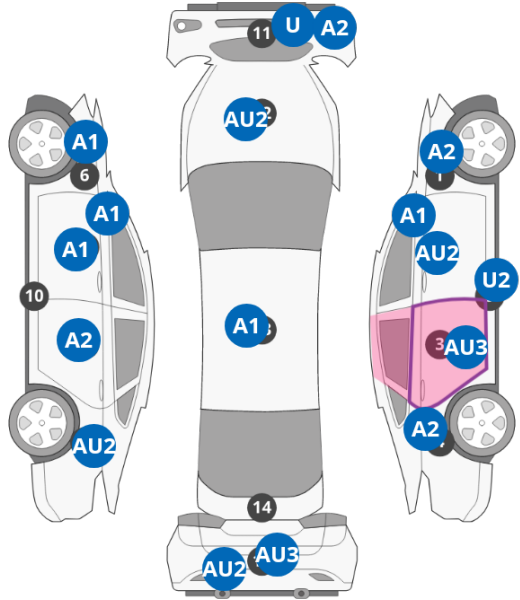
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	128	108	139
2	Boot Lid	103.0	93	107	109
3	Roof	102.4	103	120	90/97
4	Left Front Fender	103.6	103	107	101
5	Left Front Door	106.3	108	106	105
6	Center Panel Left				
7	Left Rear Door	106.3	107	101	111
8	Left Back Panel	104.6	108	103	103
9	Right Front Fender	101.3	100	103	101
10	Right Front Door	105.2	99	111	106
11	Center Panel Right				
12	Right Rear Door	109.0	104	112	111
13	Right Back Panel	108.3	109	104	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Overall Interior - Smell - Yes	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With warranty booklet and LTO Plate, Jack and Sparetire, Incomplete Tools. scratch headlight and tail light. Crack left tail light. worm tires.