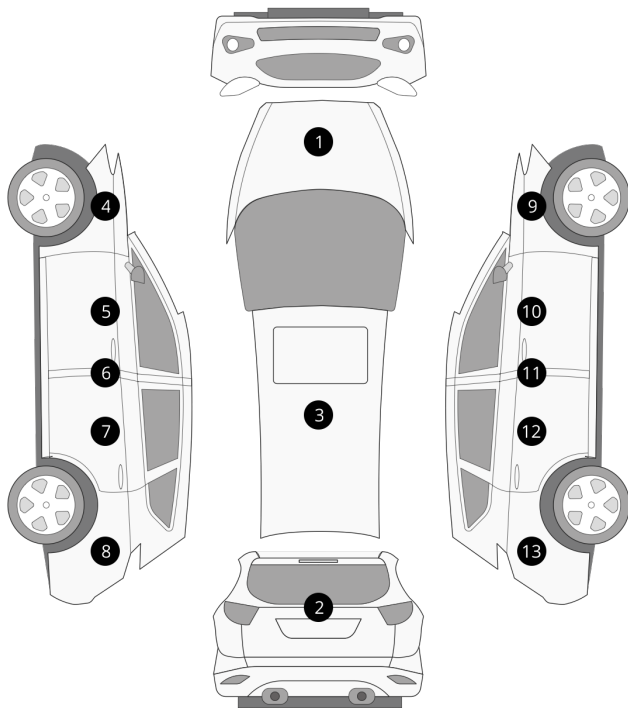


General Information

Date & Time: 21, Jul, 2025 13:11

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	80,151
Registration No.	NHI7495	Chassis No.	PA1B18F38P4207720
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



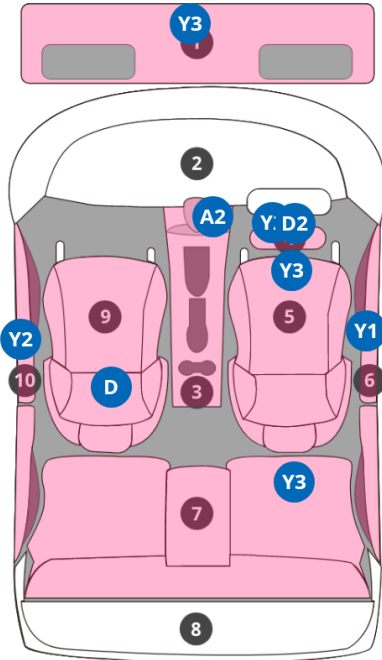
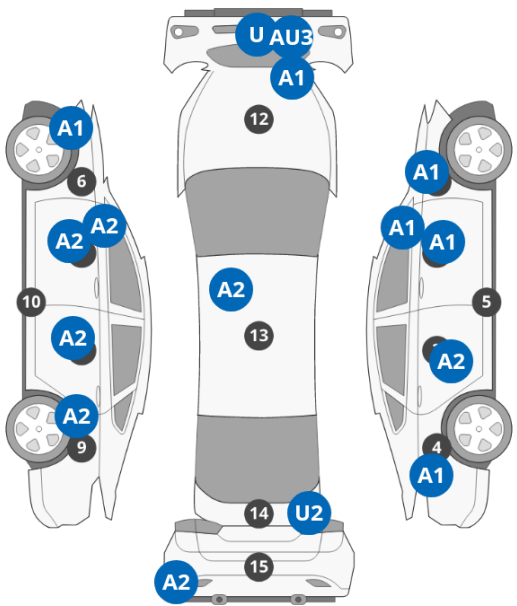
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	103	100	100
2	Boot Lid	96.3	97	89	103
3	Roof	91.0	90	93	84/96
4	Left Front Fender	180.6	215	195	132
5	Left Front Door	87.4	86	92	84
6	Center Panel Left				
7	Left Rear Door	88.4	87	89	90
8	Left Back Panel	93.7	102	89	90
9	Right Front Fender	91.2	90	86	97
10	Right Front Door	93.3	92	93	95
11	Center Panel Right				
12	Right Rear Door	94.9	98	90	97
13	Right Back Panel	210.3	212	210	209

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Mat Other - Grime - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light