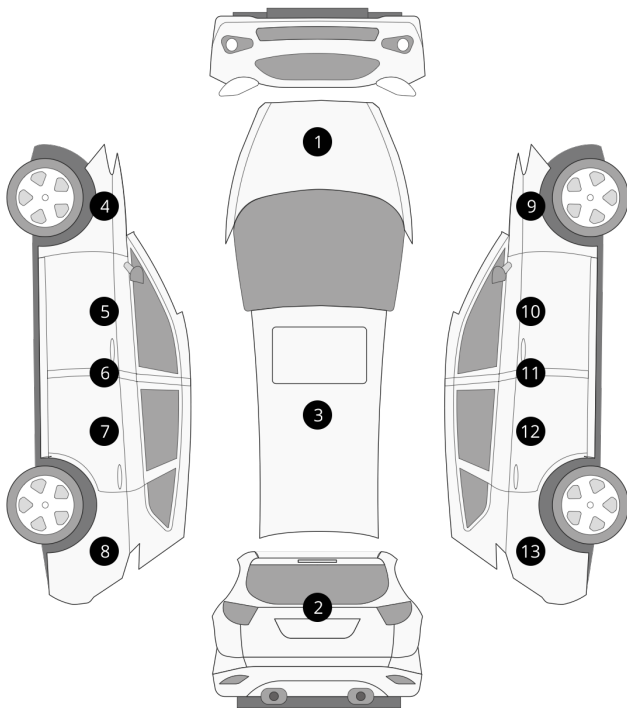


General Information

Date & Time: 21, Jul, 2025 10:56

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	118,794
Registration No.	NFB1661	Chassis No.	PA1B18F30P4206822
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



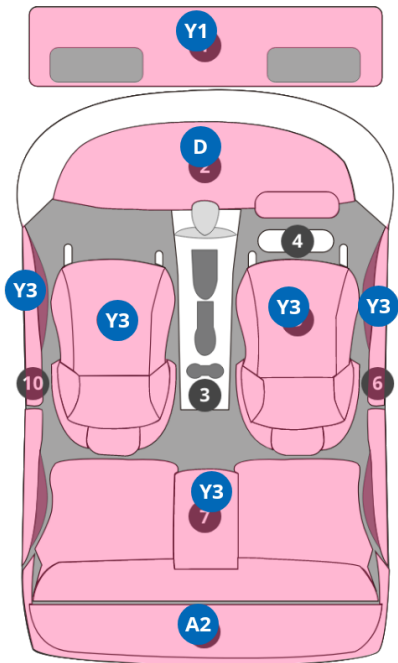
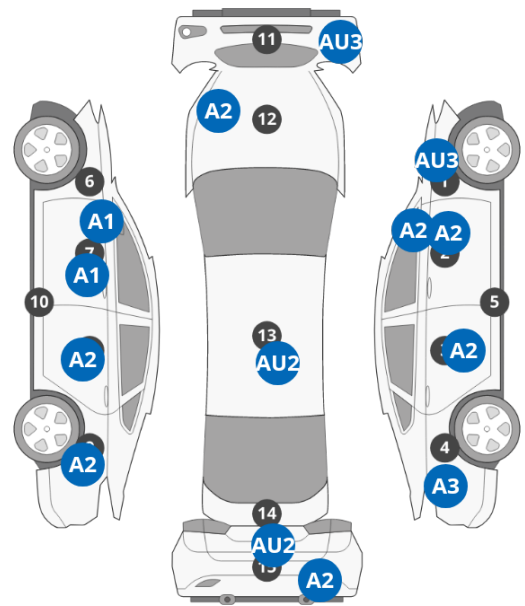
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.5	97	95	95
2	Boot Lid	100.1	97	100	104
3	Roof	90.1	93	86	90/92
4	Left Front Fender	85.7	85	85	88
5	Left Front Door	87.5	91	84	88
6	Center Panel Left				
7	Left Rear Door	94.6	108	89	87
8	Left Back Panel	99.7	105	96	98
9	Right Front Fender	91.0	96	90	88
10	Right Front Door	84.0	83	85	85
11	Center Panel Right				
12	Right Rear Door	89.7	85	93	92
13	Right Back Panel	98.0	91	94	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare/with jack No tools/with warranty booklet/reverse camera not working/ Plate light issue